



Heritage Auto Pro
 8304 Fairmount Dr. SE
 Calgary, AB. T2H0Y8
 Phone: (403)-258-3030 | Fax: (403)-258-3161
 www.heritageautopro.ca
 Keeping your car on the road longer!

Invoice # **027221**
 Original Est # 30246
 816474670R

Paid Balance Due: **\$0.00**

Invoice

	2010 Buick - Enclave - CXL	Work Complete:	01-21-2021
	3.6L, V6 (217CI) VIN(D)	Service Advisor:	
	VIN: 5GALVCEDX AJ217919	Customer ID:	10468
	Odometer: In 277,281	License Plate: AB	Printed Date: 03-23-2026

Type	Description	Qty	Sale	Total
Job Title				\$4,789.90
Labor	Diagnose no start, customer notes vehicle died while driving, lost power steering, coasted to a completed stop and will not restart, please inspect			\$0.00
Labor	Vehicle was towed in December 20th 2020 on further inspection there is a loud noise coming from the engine, there is a lot of metal filings on the engine oil, confirmed engine failure/ seized. Technician suspect Rod or timing chain(s) are out. Recommend new or used long block.			\$0.00
Part	5W30 Mobil 1000	10.40	\$5.95	\$61.88
Part	Autolite Iridium XP Plug	6.00	\$27.57	\$165.42
Labor	SPARK PLUGS - Remove & Replace - All Applicable Models - [Includes: R&I Intake Manifold. Includes: R&I Ignition Coils.]			\$324.00
Part	INTAKE MANIFOLD GASKET SET	1.00	\$196.58	\$196.58
Part	New Water Pump	1.00	\$249.38	\$249.38
Part	THERMOSTAT/Engine Coolant Thermostat	1.00	\$56.10	\$56.10
Labor	ENGINE ASSEMBLY - Removal & Installation - AWD - [Includes: Recover, Evacuate and Recharge Air Conditioning System.] - [Includes: R&I only those components necessary for the removal of the complete Engine Assembly. DOES NOT include transfer components or Costumer supplied his own engine no warranty on parts or labor			\$1,593.00
Note	Fluid Capacity: Engine Coolant - Volume: 11.40 QTS. (10.8L) - 50/50 mixture of DEX-COOL and clean, drinkable water; All Applicable Models - (Note: All capacities are approximate. When adding, be sure to fill to the approximate level. Recheck the fluid level after filling.)			
Note	Fluid Capacity: Engine Oil - Volume: 5.50 QTS. (5.2L) - API - SAE 5W-30; w/Filter - (Note: Use oil that meets GM Standard GM6094M. For areas of extreme cold, where temperatures fall below -20Deg.F (-29Deg.C), it is recommended a SAE 5W-30 synthetic oil or a SAE 10W-30 oil. Both will provide easier cold starting and better protection for your engine at extremely low temperatures. All capacities are approximate. When adding, be sure to fill to the approximate level. Recheck the fluid level after filling.)			
Part	Generic Filter	1.00	\$9.00	\$9.00
Part	Oil Filter Housing Gskt	1.00	\$12.63	\$12.63
Part	COOLANT - UNIVERSAL MAX LIFE	10.00	\$9.00	\$90.00
Part	EXH MANIFOLD SET	1.00	\$249.74	\$249.74
Part	Variable Valve Timing (VVT) Solenoid	4.00	\$124.92	\$499.68
Part	Water Outlet Gasket	1.00	\$20.43	\$20.43
Part	Flexplate Flywheel Bolts - Torque-to-Yield	8.00	\$9.99	\$79.92
Part	GDI Gasket	1.00	\$35.83	\$35.83
Part	GDI O-Ring	1.00	\$27.05	\$27.05
Part	POWER STEERING FLUID 1L	3.00	\$25.71	\$77.13
Part	Power Steering Rack & Pinion - Complete - Remfd	1.00	\$557.58	\$557.58
Part	Power Steering Rack & Pinion - Complete - Remfd <CORE>	1.00	\$0.00	\$0.00
Part	HARDWARE GASKETS	2.00	\$14.26	\$28.52

Type	Description	Qty	Sale	Total
[Continued]				\$4,789.90
Part	HARDWARE GASKETS	1.00	\$32.48	\$32.48
Part	Belt - Serpentine	1.00	\$67.71	\$67.71
Part	Oil Filter (ProSelect) - Master Pack	1.00	\$7.77	\$7.77
Note	Spoke with Leonard at Jack Carter, ENGINEERING NOTE: engine came with wrong engine oil cap reading 0w20 motor oil. We are to change oil caps with original engine to ensure engine oil cap reads 5w30 as original.			
Labor	Replace ball joint driver front - no charge labour			\$0.00
Part	BALL JOINT	1.00	\$119.98	\$119.98
Labor	Aligment no cost			\$0.00

Parts: \$2,644.81 Labor: \$1,917.00 Tax: \$228.09 Total: \$4,789.90

Order **\$127.49**

Misc	environmental and waste			\$21.42
Misc	Shop Supplies			\$100.00
Total: \$127.49		Tax: \$6.07		

Recommendations

- Brake Fluid - Dirty, recommend to flush.
- Transmission Fluid - Dirty and due by mileage
- Power Steering Fluid - Recommend to flush by mileage
- Air Filter - Dirty, recommend to replace.
- Cabin Filter - Recommend by mileage
- Spark Plugs - Recommend by mileage
- Fuel System Cleaning - Recommend by mileage.
- Battery - Battery seems weak, may need to be charged.
- Drive Belt - Serpentine belt is worn out start to crack.
- Rotors - Rotors are Rusty and scored
- Rack & Pinion - Leaking
- Shocks / Struts - Recommend by mileage
- Driveshaft - Right front drive shaft outer CV boot is cracked leaking grease
- Differential - Recommend service due by mileage.
- Next oil change occurs at 282,164 Miles - Basic OIL Change

www.heritageautopro.com

RETORQUE YOUR TIRES AFTER 100 KMS OR 4 DAYS AFTER ANY SERVICE PERFORM.

An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is two years or 24,000 miles whichever comes first. Warranty work has to be performed in our shop OR AT THE NAPA NETWORK CALL 1866-GET-NAPA & cannot exceed the original cost of repair. NO WARRANTY FOR PARTS SUPPLIED BY COSTUMER , NO WARRANTY ON ELECTRICAL COMPONENTS, OIL SEALS OR RHD VEHICLES

Labor	\$1,917.00
Parts	\$2,644.81
environmental and	\$21.42
Shop Supplies	\$100.00
Subtotal	\$4,683.23
Taxes	\$234.16
Order Total:	\$4,917.39

Payment

Debit Paid \$2500.00 on 1-21-2021
MasterCard Paid \$2417.39 on 1-21-2021

Signature _____ Date _____ Time _____