

286105

INVOICE

DUPLICATE 1
PAGE 1HYATT
INFINITIDEERFOOT - CORNER OF HERITAGE
46 HERITAGE MEADOWS RD. SE
CALGARY, ALBERTA T2H 3C1
TELEPHONE: (403) 258-2255 FAX: (403) 258-2458
www.hyattinfiniti.com

SERVICE ADVISOR: 615 ROBERT OBRONT

IN SERVICE DATE	DEL. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
20AUG26 IS							
20AUG26 DI			15:00 28AUG26		0.00	CASH	01SEP26
R.O. OPENED		READY		OPTIONS:			
28AUG26		01SEP26					

LINE	OPCODE	TECH	TYPE	HOURS	RETAIL	NET	TOTAL
------	--------	------	------	-------	--------	-----	-------

A WIRING REPAIR

CAUSE: DIAGNOSIS COMPLETE.

710 REPAIR WIRING AS PER TECH REC --SEE
TECHNICIAN NOTES

PARTS: 636 C 675.00 675.00
 98515 0.00 LABOR: 675.00 OTHER: 0.00 TOTAL LINE A: 675.00

UPON OBSERVATION, FACTORY WIRING HARNESS HAS BEEN MODIFIED PRIOR TO WORKING ON VEHICLE. MULTIPLE CONNECTORS THAT SHOULD BE THERE ARE MISSING AND INSTEAD HARD WIRED STRAIGHT INTO THE REST OF THE HARNESS. THESE CONNECTORS ARE SUPPOSED TO BE THERE TO SEPERATE THE HARNESS FROM THE BODY WHILE DROPPING SUBFRAME AND ENGINE. THIS INTERFERES WITH THE PROCESS SINCE THE WIRING IS STIL CONNECTED TO THE REST OF THE BODY. CUTTING THE WIRES AND RE CONNECTING THEM WAS NEEDED IN ORDER TO SEPERATE SUBFRAME AND BODY. WIRES WERE ALL LABELLED INDIVIDUALLY BEFORE CUTTING AND REWIRING. BEFORE CUTTING NOTICED WIRE COLOURS DO NOT MATCH THE PROPER WIRES ON OTHER END OF WIRING JOB DONE PRIOR TO THE VEHICLE COMING TO THE SHOP. VEHICLE WAS REWIRED EXACTLY HOW IT CAME IN. SUBSEQUENTLY ALL THE PREVIOUS CODES ARE STILL PRESENT. ALSO NOTICED MULTIPLE CONNECTORS MISSING EITHER THE MALE OR FEMALE END ON THE HARNESS. AND MULTIPLE CONNECTORS HAVE BEEN TAPED OFF AND TUCKED AWAY PRIOR TO WORKING ON THE VEHICLE.

ESTIMATE: 675.00 28AUG26 09:52 SA: 615

CONTACT:

"At Your Service"

Monday to Friday
7:00 am - 6:00 pm
Saturday by appointmentSERVICE
258-2255

*Thank you
for
allowing us to
service
your vehicle*

DESCRIPTION	
LABOUR AMOUNT	
PARTS AMOUNT	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
INSURANCE/PAYABLE	
G.S.T.	
PAY THIS AMOUNT	

GST # 828512772 RT0001

We and our service providers and affiliates will use the information provided by you to (i) perform services as may be directly requested by you; (ii) provide more information regarding the products and services of us, our affiliates and business partners; (iii) Generate statistical and aggregated data that does not identify you personally, and (iv) disclose your information to our service providers and affiliates for the purpose of providing services to you and to provide you more information regarding their products and services. By providing your information to us, you consent to these uses. You may notify us in writing if in the future you do not consent to any of these uses of the information you provide.

CUSTOMER COPY

HYATT
INFINITI

CUSTOMER #: 195652

285963

INVOICE

PAGE 2



**HYATT
INFRONT**

DEERFOOT - CORNER OF HERITAGE
46 HERITAGE MEADOWS RD. SE
CALGARY, ALBERTA T2H 3C1
TELEPHONE: (403) 258-2255 FAX: (403) 258-2458
www.hyattinfront.com

SERVICE ADVISOR: 615 ROBERT OBRONT

IN SERVICE DATE	DEL. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
20AUG26 IS							
20AUG26 DE							
R.O. OPENED	READY	14:00	21AUG26		0.00	CASH	01SEP26

LINE	OPCODE	TECH	TYPE	HOURS	RETAIL	NET	TOTAL
------	--------	------	------	-------	--------	-----	-------

2	22693-5CA0A	SENSOR					(N/C)
2	21639-7990A	CLAMP					(N/C)
2	92472-N823A	RING					(N/C)
1	92474-N823A	RING					(N/C)
1	92473-N823A	O-RING					(N/C)
1	92471-N823A	RING					(N/C)
5	20602-41G0A	NUT					(N/C)
1	20691-19U0A	GASKET-EXHAUST					(N/C)
1	20813-5CA0A	SILICON GASKT					(N/C)
2	20692-JK00B	GASKET-EXHAUST					(N/C)

FC: ZE32

PART#: 14411-5CA6C

COUNT: 1

CLAIM TYPE: PP

AUTH CODE:

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

98509 DX64AA ZE32 8.4
CONFIRMED CUSTOMER CONCERN . TEST DROVE VEHICLE , OBSERVED SMOKE
COMING OUT OF EXHAUST DURING TEST DRIVE . VEHICLE ALSO HAS A CHECK
ENGINE LIGHT ON . NOISE SEEMED TO BE COMING FROM PASSENGER SIDE ENGINE
BAY TURBO . INSPECTED TURBO AND INTAKE PIPING . FOUND EXCESSIVE AMOUNT
OF OIL LEAKING IN PASSENGER SIDE INTAKE AND DRIVER SIDE INTAKE IS
BEGINNING TO LEAK OIL AS WELL . VIDEO ATTACHED TO XTIME .
REPLACED BOTH TURBO CHARGERS , RESEALED ALL GASKETS TAKEN OFF
DURING REASSEMBLY . PERFORMED NECESSARY PROGRAMMING . TEST DROVE
VEHICLE . NO ISSUES CONCERNING TURBO CHARGER REPLACEMENT .

B MULTI POINT INSPECTION

MPI IF YOUR WHEELS WERE REMOVED ON YOUR SERVICE
TODAY - PLEASE RETURN TO THE DEALERSHIP IN

"At Your Service"

Monday to Friday
7:00 am - 6:00 pm
Saturday by appointment

SERVICE
258-2255

*Thank you
for
allowing us to
service
your vehicle*

DESCRIPTION	
LABOUR AMOUNT	
PARTS AMOUNT	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
INSURANCE/PAYABLE	
G.S.T.	
PAY THIS AMOUNT	

GST # 828512772 RTO001

We and our service providers and affiliates will use the information provided by you to (i) perform services as may be directly requested by you; (ii) provide more information regarding the products and services of us, our affiliates and business partners; (iii) Generate statistical and aggregated data that does not identify you personally; and (iv) disclose your information to our service providers and affiliates for the purpose of providing services to you and to provide you more information regarding their products and services. By providing your information to us, you consent to these uses. You may notify us in writing if in the future you do not consent to any of these uses of the information you provide.

CUSTOMER COPY



**HYATT
INFRONT**

285963

INVOICE

PAGE 3


**HYATT
INFINITI**

 DEERFOOT - CORNER OF HERITAGE
 46 HERITAGE MEADOWS RD. SE
 CALGARY, ALBERTA T2H 3C1

 TELEPHONE: (403) 258-2255 FAX: (403) 258-2458
 www.hyattinfiniti.com

SERVICE ADVISOR: 615 ROBERT OBRONT

IN SERVICE DATE	DEL. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
20AUG26 IS							
20AUG26 DD			14:00 21AUG26		0.00	CASH	01SEP26
R.O. OPENED		READY		OPTIONS:			
21AUG26		01SEP26					

LINE	OPCODE	TECH	TYPE	HOURS	RETAIL	NET	TOTAL
------	--------	------	------	-------	--------	-----	-------

100KMS FOR A WHEEL RE-TORQUE

636 IPSC

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

98509 PERFORMED MPI AND SUBMITTED RECOMMENDATIONS

ESTIMATE: 225.00

21AUG26 11:20 SA: 615

CONTACT:

 #4577 SHUTTLE
 DMINE97911201DMINE

 * HYATT INFINITI RECOMMENDS *
 * RE-TORQUING YOUR WHEEL NUTS *
 * AFTER 100KMS OF DRIVING *
 * - NO APPOINTMENT REQUIRED - *

"At Your Service"
 Monday to Friday
 7:00 am - 6:00 pm
 Saturday by appointment

 SERVICE
 258-2255

*Thank you
for
allowing us to
service
your vehicle*

DESCRIPTION	
LABOUR AMOUNT	0.00
PARTS AMOUNT	0.00
	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	0.00
INSURANCE/PAYABLE	0.00
G.S.T.	0.00
PAY THIS AMOUNT	0.00

GST # 828512772 RT0001

We and our service providers and affiliates will use the information provided by you to (i) perform services as may be directly requested by you; (ii) provide more information regarding the products and services of us, our affiliates and business partners; (iii) generate statistical and aggregated data that does not identify you personally; and (iv) disclose your information to our service providers and affiliates for the purpose of providing services to you and to provide you more information regarding their products and services. By providing your information to us, you consent to these uses. You may notify us in writing if in the future you do not consent to any of these uses of the information you provide.

CUSTOMER COPY


**HYATT
INFINITI**

286105

INVOICE

DUPLICATE 1
PAGE 2HYATT
INFINITI

DEERFOOT - CORNER OF HERITAGE

46 HERITAGE MEADOWS RD. SE

CALGARY, ALBERTA T2H 3C1

TELEPHONE: (403) 258-2255 FAX: (403) 258-2458


www.hyattinfiniti.com

SERVICE ADVISOR: 615 ROBERT OBRONT

Blue		18	INFINITI Q50		JN1FV7AR8JM480822	98515/98515		T4577A
IN SERVICE DATE	DEL. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
20AUG26 IS			15:00 28AUG26		0.00	CASH	01SEP26	
20AUG26 DI								
R.O. OPENED		READY		OPTIONS:				
28AUG26		01SEP26						

LINE	OPCODE	TECH	TYPE	HOURS	RETAIL	NET	TOTAL

*					HYATT INFINITI RECOMMENDS		*
*					RE-TORQUING YOUR WHEEL NUTS		*
*					AFTER 100KMS OF DRIVING		*
*					- NO APPOINTMENT REQUIRED -		*

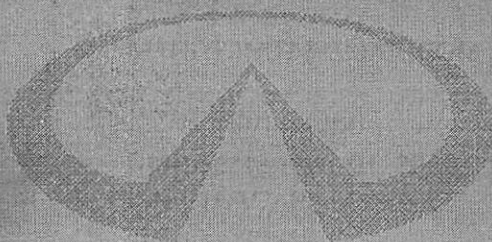

I N F I N I T I

GST TAX

(#: R136888294)

39.20

"At Your Service"Monday to Friday
7:00 am - 6:00 pm
Saturday by appointmentSERVICE
258-2255

*Thank you
for
allowing us to
service
your vehicle*

DESCRIPTION	
LABOUR AMOUNT	675.00
PARTS AMOUNT	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	109.00
TOTAL CHARGES	784.00
INSURANCE/PAYABLE	0.00
G.S.T.	39.20
PAY THIS AMOUNT	823.20

GST # B28612772 RT0001

We and our service providers and affiliates will use the information provided by you to (i) perform services as may be directly requested by you; (ii) provide more information regarding the products and services of us, our affiliates and business partners; (iii) Generate statistical and aggregated data that does not identify you personally; and (iv) disclose your information to our service providers and affiliates for the purpose of providing services to you and to provide you more information regarding their products and services. By providing your information to us, you consent to these uses. You may notify us in writing if in the future you do not consent to any of these uses of the information you provide.

CUSTOMER COPY

HYATT
INFINITI

Multi-Point Inspection Form

VIN JN1FV7AR8JM480822

Advisor Robert Obront
Technician Bimen Nached
Created On 9/1/2026

☒ Checked and OK at this time

☐ May Require Future Attention

☐ Requires immediate attention

Interior / Exterior

- ☒ Bulbs and Lights
- ☒ Windshield Washer Spray / Wiper Operation / Wiper Blades / Including Rear (if applicable)
- ☒ Windshield / Window Condition
- ☒ Upholstery / Carpet / Floor Mats / Mirrors / Trim
- ☒ Emergency Brake Adjustment
- ☒ Horn Operation
- ☒ Fuel Tank Cap Gasket
- ☒ Clutch Operation (if equipped)
- ☒ Cabin/HEPA Filter (if equipped)

Battery Performance

- ☒ Battery Terminals / Cables / Mountings
- ☒ Check Condition of Battery (Storage Capacity Test if Applicable)

Under Hood

- ☒ Fluids: Oil / Coolant / Power Steering / Brake Fluid / Washer
- ☒ Engine Air Filter
- ☒ Belts / Tensioners (condition and adjustment)
- ☒ Cooling System Hoses / Heater Hoses / Air Conditioning Hoses and Connections
- ☒ Radiator Core / Air Conditioning Condenser (if equipped)

Under Vehicle

- ☒ Shock Absorbers / Suspension
- ☒ Steering Gear Box / Linkage and Boots / Ball Joints / Dust Covers
- ☒ Muffler / Exhaust Pipes / Mountings
- ☒ Engine Oil and/or Fluid Leaks
- ☒ Drive Shaft Boots / Constant Velocity Boots / U-joints / Transmission Linkage (if equipped)
- ☒ Transmission / Differential / Transfer Case (Check Fluid Level, Fluid Condition and Fluid Leaks)
- ☒ Fuel Lines and Connections / Fuel Tank Band / Fuel Tank Vapor Vent System Hoses
- ☒ Inspect Nuts and Bolts on Body Chassis

Tread Depth (measured in millimeters)



- ☒ LF 6
- ☒ RF 6
- ☒ LR 6
- ☒ RR 6
- ☒ Spare Tire (if applicable)
- ☒ LF/RF Tire Pressure 35
- ☒ LR/RR Tire Pressure 35

Abnormal Wear Pattern of Tires

- ☒ LF
- ☒ RF
- ☒ LR
- ☒ RR

Check Brake Linings (measured in millimeters)

- ☒ LF 2
- ☒ RF 2
- ☒ LR 2
- ☒ RR 2