



GOOSE
 5809 54th Ave
 Bonnyville, AB T9N 0C4
 (780) 201-4476
 service@goosemaintenance.com
 https://www.goosemaintenance.ca

Invoice for RO #27917

Service Advisor: Lisa Sargent
 Date Created: 01/05/26 at 09:58 AM MST
 Client: [REDACTED]
 Vehicle: 2015 Subaru Forester 2.5i Limited

	2015 Subaru Forester 2.5i Limited 2.5L 4Cyl GAS FB25 Naturally Aspirated VIN: JF2SJAHC4FH454757 License: [REDACTED] Color: Blue Odometer In: 175712 / Out: 175712	RO # 27917
--	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------

1 - Perform mechanical diagnosis on transmission. As AWD solenoid is in transmission		
	Perform mechanical diagnosis on transmission. As AWD solenoid is in transmission Right front axle seal leaking? Took unit for test drive confirmed unit still does not have operational AWD Transfer duty cycle still reading 0% Got fluid temp up to operating range. Checked fluid level and condition both were good Scanned for codes still no codes present but AWD light is flashing on dash. Found AWD flashing indicates a fault Performed differential learn. Learned successfully Swapped TCM to FWD and back to AWD Successfully swapped back to AWD and light has now stopped flashing and went out. Took unit for test drive and now Transfer duty cycle reads in drive and reverse. While driving can feel AWD attempting to work on occasions but does not seem consistent. Tested for Transfer clutch pressure with mechanical gauge. No pressure recorded. But can still feel AWD kicking in on occasion. With no pressure reading suspect mechanical failure of AWD solenoid. Performed transmission learn and went for test drive AWD now seems to be working all the time. Will have to get customer to drive more to confirm. No fluid in stock for this transmission cannot drop pan without replacement fluid. Will have to reschedule or get customer to proceed with more diag at dealer if issue returns/continues	
Labor:		\$527.61
✓ Approved on 01/05/26 at 09:59 AM MST		Subtotal \$527.61 + est. Tax \$26.38 \$553.99

2 - GOOSE 1 Inspection		
Labor:	Perform Inspection	\$0.00
✓ Approved on 01/07/26 at 08:15 AM MST		0 0

3 - MAJOR - Right rear brake light not working		
Labor:	Remove and replace right rear brake light	\$87.94
	Removed and replaced the right rear brake light bulb, re test verified repair ok at this time	
Part:	Standard Mini bulb	1 \$1.93 \$1.93
✓ Approved on 01/07/26 at 04:49 PM MST		Subtotal \$89.87 + est. Tax \$4.49 \$94.36

RO Fees		
Fee:	Shop Supplies/Enviro	\$49.24
		Subtotal \$49.24

Warning: wheel nuts require retorquing after 50 kilometers. Wheel nuts should be torqued to the manufacturer's specifications when tires have been removed for repair or replacement.

We offer a 2 year 50,000 km limited warranty on workmanship and parts. Vehicle must be brought back to the shop to honor warranty.

(Turbochargers come with 1yr Warranty for Parts & Labour)

****No warranty on customer supplied parts****

Storage fees are 35\$ per day after vehicle has not been picked up within 1 week of repair.

* If the vehicle invoice is not paid for after 90 days we have the right to sell the vehicle for the invoice amount.

Total Repair Order & Signature:

Total Jobs: \$617.48
 Total Fees: \$49.24
Subtotal: \$666.72
 Taxes: \$33.34
Grand Total: \$700.06
BALANCE DUE: \$0.00

X

PAID

Completed Transactions					
01/08/26	[REDACTED]	\$700.06	Credit Card Payment	Mastercard*** [REDACTED]	Chip Mastercard AID:A0000000041010

Declined Jobs:

1 - MINOR - Rear wiper does not work	X Declined on 01/07/26 at 04:47 PM MST	<i>Subtotal \$175.87 + est. Tax \$8.79</i>	\$184.66
2 - MINOR - Accessory drive belt has crack	X Declined on 01/07/26 at 04:47 PM MST	<i>Subtotal \$267.21 + est. Tax \$13.36</i>	\$280.57
3 - MINOR - Right front CV axle - boot torn leaking grease	X Declined on 01/07/26 at 04:47 PM MST	<i>Subtotal \$525.69 + est. Tax \$26.28</i>	\$551.97
4 - MINOR - Right front axle seal - light sweat	X Declined on 01/07/26 at 04:47 PM MST	<i>Subtotal \$169.97 + est. Tax \$8.50</i>	\$178.47
5 - MINOR - Rear brake service - inner pad wearing faster than outer	X Declined on 01/07/26 at 04:47 PM MST	<i>Subtotal \$175.87 + est. Tax \$8.79</i>	\$184.66
6 - Minor-Right Front Side Marker-inop	X Declined on 01/07/26 at 04:47 PM MST	<i>Subtotal \$45.24 + est. Tax \$2.26</i>	\$47.50

7 - Windshield Replacement

X Declined on 01/07/26 at 04:47 PM MST

Subtotal \$666.10 + est. Tax \$33.31

\$699.41

Alberta Asian MotorWorks

Are You Ready for Our Premium Level of Service?

Unit #1 5804 50 Avenue

Red Deer, AB T4N4C2

Phone: (587) 273-2269 Fax: (403) 341-3021 Email: mike.pasman@aamw.ca

GST # 87035 0741 RT0001

Invoice

Bill To

Cell
Email

Invoice # 15934
Work Order # 18786
Service Advisor Jordan O
Technician Andrew McIlravey

Plate AB
Description 2015 Subaru Forester 2.5i Limited H4 2.5L
2498CC 152CID
VIN JF2SJAHC4FH454757
Odometer 287,491
Invoice Date 3/26/2026 5:06 PM
Appointment 3/26/2026 8:36 AM
Promised 3/26/2026 5:30 PM

Concern

Drive Train / Line Concern

Concern? = Found that only the front wheels are driving. Verify concern and diagnose the reason.

Labor

\$0.00 G

Sub \$0.00

Inspection

Alberta Asian Motorworks Digital Health and Reliability Report

Complimentary Inspection Report (\$89.95 VALUE)

Please note: if there is a dash cam present in the vehicle, it will be disabled during appointment here at AAMW

Labor

\$0.00 G

Sub \$0.00

Key # L2

Wheels Removed - Yes _____ No X _____

Torque Specification - _____ ft/lbs

Gas pedal is extremely touchy-Recommend pinpoint inspection.

Back wheels do not spin-during the generic inspection noted that everything rearward on the transfer case operates as it should.

Tire Pressure Monitor System (TPMS) Light On

Front Marker Light Out

Coolant Fails Protection Level Testing - Coolant Fluid Exchange Recommended

Engine Oil Level Low Before Service

Battery Terminals Corroded

Brake Fluid Moisture Content Above 0%

Drive Train (Final Drive, Differential & Transfer Case) Pinpoint Inspection

Labor

\$129.95 G

Sub \$129.95

Hoisted vehicle and spun rear driveshaft by hand, confirming the rear differential is intact by the rear wheels spinning in conjunction with the driveshaft. Overlooked exploded parts diagram of transmission and confirmed there is a clutch pack driving the rear driveshaft indicating a fluid solenoid circuit in the transmission must be active to engage the rear driveshaft. Started vehicle and placed in Drive while on hoist and released brake pedal confirming that the front wheels are getting power and the rear wheels are not. Accelerated vehicle on hoist and found rear wheels will spin however are receiving less torque than the front wheels, spinning at a fraction of the speed of the fronts. Scanned for codes and found no fault codes related to the drivetrain. Using scan tool, confirmed vehicle is in AWD mode. Confirmed the transfer clutch duty ratio reaches 99% however wheels speeds still do not match indicating either a fluid pressure concern or a worn clutch concern. Performed Transfer Clutch Fluid Pressure test and found 0psi on the transfer clutch even with duty cycle reaching 99% indicating that there is an issue within the fluid pressure circuit, likely caused by a stuck solenoid. Due to not having any codes in the TCM, the electrical circuit for controlling the solenoid is intact however the solenoid could be sticking or there could be debris plugging the fluid circuit for the transfer clutch. At this time, recommend either removing the valve body for inspection of the Transfer Clutch Solenoid to identify if the solenoid is sticking or if there is a fluid restriction existing within the system OR replacing the transmission to restore AWD function.

Service

Continued Diagnostic Time

Initial diagnosis, testing and inspection of the specific vehicle system as required. Perform road test where applicable. Report test result(s), system fault(s), component(s) failure and required repair(s). Additional diagnosis and testing time may be required at additional charges.

Labor		\$95.98 G
	Sub	\$95.98

Total Parts		\$0.00
Total Labor		\$225.93
Total Before Taxes & Miscellaneous Charges		<u>\$225.93</u>
(E) Environmental Disposal Charge	\$2.50 Each	\$2.50 G
(S) Shop Supplies	3.5 %	\$7.91 G
(G) Canadian Goods and Services Tax (GST)	5 %	<u>\$11.82</u>
Grand Total		\$248.16

[Redacted] paid \$248.16 by Visa
 3/26/2026 5:05 PM Card #: XXXXX [Redacted] Sale Amount: 248.16
 Terminal: 71031 Transaction: fe20d315-5636-4a92-9c14-641517490cf4 Authorization: 067276 Result: Approved
 AID: A000000031010 TC: ARQC: E645A2986B4C1B2D TVR: 0000000000 TSI: 0000
 Surcharge Fee: \$0.00

Buyer agrees to pay total amount above according to cardholder's agreement with issuer.

Thank you for trusting us with your vehicle!

I acknowledge receipt of the vehicle and the indebtedness indicated herein.

Labor and parts on new, non friction material parts are guaranteed for either 36 months or 36,000 km to original purchaser, whichever comes first, when returned to our service department for adjustments or repairs. No reimbursements of any kind will be made for repairs at other facilities, or towing, unless arrangements are made prior to the event. All parts are new unless otherwise specified. There is no parts or labor warranty on aftermarket, performance, used parts and or customer supplied parts.

Customer Signature: _____

Deferred Service

Automatic Transmission Assembly, Remove & Install

Remove and Replace components as required to access and install materials, and/or perform needed service, adjustments as required. Additional fluids may be required to complete this service. Retest and verify repair as required. Perform final road test where applicable.

Transmission Assembly - Used 140K	1 Unit	\$4,181.82 G
Labor		\$1,477.71 G
		Sub <u>\$5,659.53</u>

Automatic Transmission Fluid & Filter Service

Remove and Replace components as required to access and install materials, and/or perform needed service, adjustments as required. Remove existing fluid(s). Additional chemicals may be added to completely clean system contamination. Fill system fluid(s) to proper capacity with new fluid. Fluid additives and/or conditioners may be required. Leak test vehicle system. Perform final road test where applicable.

AT Filter	1 Unit	\$159.87 G
AT Filter	1 Unit	\$139.45 G
CVT Fluid- Top Tech 1400	6.5 Unit	\$247.72 G
Labor		\$70.28 G
		Sub <u>\$617.32</u>

Diagnose Valve Body Fault

Initial diagnosis, testing and inspection of the specific vehicle system as required. Perform road test where applicable. Report test result(s), system fault(s), component(s) failure and required repair(s). Additional diagnosis and testing time may be required at additional charges.

Labor		\$863.86 G
		Sub <u>\$863.86</u>

Total Parts		\$4,728.86
Total Labor		\$2,411.85
Total Before Taxes & Miscellaneous Charges		<u>\$7,140.71</u>
(E) Environmental Disposal Charge	\$2.50 Each	\$2.50 G
(S) Shop Supplies	3.5 %	\$150.00 G
(G) Canadian Goods and Services Tax (GST)	5 %	<u>\$364.67</u>
Grand Total		\$7,657.88

All Toys & Trucks

UNLOCK YOUR IMAGINATION

75 9 Ave SE
 High River, AB
 T1V 1E7
 403-601-2663 alltoys@shaw.ca

Invoice

Date	Invoice #
5/8/2025	45119



Invoice To
[REDACTED]

Vehicle	Mileage
2015 Forester	168594

Qty	Description	Rate	Amount
1	RF CV halfshaft	241.22	241.22
1	Oil filter	14.95	14.95
4.8	0W20 synthetic oil	15.95	76.56
1.4	Labour	124.00	173.60
1	Total wheel alignment	139.95	139.95
4	Mount & balance summer tires	40.95	163.80
	GST On Sales	5.00%	40.50

	Subtotal	\$810.08
Your wheels may have been torqued. Recheck is recommended in 100 kms. There is no warranty implied on customer supplied parts.	GST	\$40.50
	Total	\$850.58



SO # 167616

SERVICE INVOICE
CUSTOMER COPY



Printed 10/10/2025 9:48:34 AM

User 991347 Page 1

Customer No [REDACTED]

[REDACTED]

Home [REDACTED]

Cell [REDACTED]

Email [REDACTED]

Term Cash

Advisor	Harmony Lumley	Promised	10/07/2025 5:00 PM	Tag#	
Shop	S1	Opened	10/07/2025 8:34 AM	Location	
Priority	40	Cashiered		PO #	

License	[REDACTED]	Odom In	174010	Odom Out	174010	In Service Date	07/17/2014	Stock No	
Year	2015	Make	SUBARU	Model	FORESTER	Model Number	FFI	Colour	
Vehicle ID No	JF2SJAHC4FH454757	Selling Dealer		Extended Warranty		Delivery Date			
Engine	2.5L 4 Cyl DOHC 16V w/VVT -inc:	Fleet #							

Request	Description	Job	CSR	Status
SEMI	Complete Semi Annual inspection- \$169.00 plus shop fees and taxes- Includes inspection of all suspension components, inspect brakes/rotors, rotate tires if nec, inspect all fluid levels and top up, Inspect operation of all lights, test the battery, inspect all steering components, inspect wheel alignment and complete test drive. ----- customer was told AC compressor and front struts need replaced----- inspect and advise	1	991347	Original

Labour	Description	Type	Amount
SEMI	Complete Semi Annual inspection- \$169.00 plus shop fees and taxes- Includes inspection of all suspension components, inspect brakes/rotors, rotate tires if nec, inspect all fluid levels and top up, Inspect operation of all lights, test the battery, inspect all steering components, inspect wheel alignment and complete test drive. ----- --- customer was told AC compressor and front struts need replaced----- inspect and advise	C	169.00
Rate	169.00	Labour Total	169.00
Technician	99091 - Justin Brown	Request Sub-total	169.00

Cause SEMI

Correction ANNUAL INSPECTION COMPLETE
DID NOT ALIGNMENT CHECK AS SUSPENSION WORK REQUIRED
YELLOW TIRES DID NOT ROTATE
washer hoses routed backwards
front brakes at 3mm, bf rec as well
rear brakes good at 6mm
tires 4-5/32 around
compressor loud internal noise of bearing, failed
wiper rear torn
rf axle torn open boot, leaked grease
both fr control arms rec, RF bushing has severe play, unsafe alignment
engine large leaks present
lh head gasket, rear upper oil pan, rh cam carrier, rec full engine reseal
rec services, service d, pcv, fuel

post road test
both rear wheel bearings humming loudly
possible wheel balance - slight vibration during accel
wheels ok with current lugs, ideally should have splined lugs on aftermarket rims

Request	Description	Job	CSR	Status
USA	*****AMERICAN VEHICLE***** IN MILES	2	991347	Original

Request	Description	Job	CSR	Status
SUS	SUSPENSION REPAIR- both front control arm assys **** Safey****	9	991355	Approved

Labour	Description	Type	Amount
SUS	SUSPENSION REPAIR- both front control arm assys	C	338.00

Part	Description	Shp	Bin	Type	Price	Amount
20202SG002	ARM ASSY F RH	1	10403	CRO	409.03	409.03

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS SERVICE INVOICE AND THE ACCOMPANYING WORK ORDER.

DATE: _____ CUSTOMER SIGNATURE: _____



SO # 167616

**SERVICE INVOICE
CUSTOMER COPY**



Printed 10/10/2025 9:48:35 AM

User 991347 Page 2

Customer No [REDACTED]

Home [REDACTED]

Cell [REDACTED]

Email [REDACTED]

Term Cash

Advisor	Harmony Lumley	Promised	10/07/2025 5:00 PM	Tag#	
Shop	S1	Opened	10/07/2025 8:34 AM	Location	
Priority	40	Cashiered		PO #	

License	[REDACTED]	Odom In	174010	Odom Out	174010	In Service Date	07/17/2014	Stock No	
Year	2015	Make	SUBARU	Model	FORESTER	Model Number	FFI	Colour	
Vehicle ID No	JF2SJAHC4FH454757		Selling Dealer		Extended Warranty		Delivery Date		
Engine	2.5L 4 Cyl DOHC 16V w/VVT -inc:		Fleet #						

7 to 10 days								
2020SG012	ARM ASSY F LH	1	10403	CRO	409.03	409.03		
in stock								
023212010	CASTLE NUT	2	L02D04	CRO	1.02	2.04		
051030300	PIN 051030250	2	L02D01	CRO	0.21	0.42		
20420XA000	STABILIZER LK F	2	10404	CRO	100.52	201.04		
902370063	NUT FLG M12	4	L02D04	CRO	3.90	15.60		
Rate	169.00			Parts Total		1,037.16		
Technician	99091 - Justin Brown			Labour Total		338.00		
Cause	SUSPENSION REPAIR- both front control arm assys			Request Sub-total		1,375.16		
Correction	removed and replaced both fr control arm assys repair complete.							

Request	Description	Job	CSR	Status
4WA	4 Wheel alignment- 169.00 plus taxes and fees **** need to do with Control arm assys*****	10	991355	Approved
Labour	Description		Type	Amount
4WA	4 Wheel alignment- 169.00 plus taxes and fees		C	169.00
Rate	169.00			
Technician	99091 - Justin Brown			Labour Total 169.00
Cause	4WA			Request Sub-total 169.00
Correction	Performed alignment adjusted rear and front toe road tested, steering centered with steering bezel. repair complete			

Request	Description	Job	CSR	Status		
FRONTB	Replace front pads and rotors- \$229.00 plus shop fee and taxes (labour time only) parts are additional 3mm ***** Safety***	16	991355	Approved		
Labour	Description		Type	Amount		
FRONTB	Replace front pads and rotors- \$229.00 plus shop fee and taxes (labour time only) parts are additional 3mm		C	229.00		
Part	Description	Shp	Bin	Type	Price	Amount
26300SA001	BRAKE DISC F	2	10706	CRO	154.75	309.50
in stock						
26296SC011	PAD KIT	1	10702	CRO	219.50	219.50
in stock						
Rate	169.00			Parts Total		529.00
Technician	99091 - Justin Brown			Labour Total		229.00
Cause	FRONTB			Request Sub-total		758.00

OUT	INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS SERVICE INVOICE AND THE ACCOMPANYING WORK ORDER.
	DATE: _____ CUSTOMER SIGNATURE: _____



SO # 167616

**SERVICE INVOICE
CUSTOMER COPY**



Printed 10/10/2025 9:48:35 AM

User 991347 Page 3

Customer No [REDACTED]	Advisor Harmony Lumley	Promised 10/07/2025 5:00 PM	Tag#
Home Cell Email [REDACTED]	Shop S1	Opened 10/07/2025 8:34 AM	Location
Term Cash	Priority 40	Cashiered	PO #
	License [REDACTED]	Odom In 174010	Odom Out 174010
	Year 2015	Make SUBARU	Model FORESTER
	Vehicle ID No JF2SJAHC4FH454757	Selling Dealer	Extended Warranty
	Engine 2.5L 4 Cyl DOHC 16V w/VVT -inc:	Fleet #	Stock No
			Colour
			Delivery Date
			In Service Date 07/17/2014
			Model Number FFI

Correction removed and replaced front brake pads and rotors
serviced calipers/shims/pins
torqued wheels 90ftlbs.
burnished brakes
repair complete.
PLEASE RETORQUE LUGS IN 100 KM -

Request	Description	Job	CSR	Status
DRIVE	Driveline Repair- both rear wheel bearings **** Safety ****	19	991355	Approved
Labour	Description		Type	Amount
DRIVE	Driveline Repair- both rear wheel bearings		C	507.00
Part	Description	Shp	Bin	Type
902170049	NUT	2	L02D04	CRO
in stock				Price
28473FL040	HUB UNIT COMPL R NML	2	10502	CRO
in stock				Amount
Rate	169.00			731.00
Technician	99091 - Justin Brown			751.50
Cause	Driveline Repair- both rear wheel bearings			507.00
Correction	removed rear brakes, removed and replaced both rear wheel bearings with new axle nuts reinstalled brakes			
	torqued wheels 90ftlbs			
			Request Sub-total	1,258.50

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS SERVICE INVOICE AND THE ACCOMPANYING WORK ORDER.

DATE: _____ CUSTOMER SIGNATURE: _____



SO # 167616

**SERVICE INVOICE
CUSTOMER COPY**



Printed 10/10/2025 9:48:35 AM

User 991347 Page 4

Customer No [REDACTED]

[REDACTED]

Home [REDACTED]

Cell [REDACTED]

Email [REDACTED]

Term Cash

Advisor	Harmony Lumley	Promised	10/07/2025 5:00 PM	Tag#	
Shop	S1	Opened	10/07/2025 8:34 AM	Location	
Priority	40	Cashiered		PO #	

License	Odom In	Odom Out	In Service Date	Stock No
[REDACTED]	174010	174010	07/17/2014	
Year	Make	Model	Model Number	Colour
2015	SUBARU	FORESTER	FFI	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
JF2SJAH4C4FH454757				
Engine	2.5L 4 Cyl DOHC 16V w/VVT -inc:	Fleet #		

SHUTTLE Xtime Web Appt created 2025-10-03 04:43:43pm taken by

Labour	1,412.00
Parts	2,317.66
Supplies	57.00
Discount	(223.78)
Sub-Total	3,562.88
GST	178.14
Total Invoice	3,741.02

Additional Work Authorization

Date / Time	Contact	Phone Number	Comments	Amount
10/07/2025 2:55:25 PM	[REDACTED]	[REDACTED]		\$1,291.68
10/07/2025 2:55:31 PM	[REDACTED]	[REDACTED]		\$194.35
10/07/2025 2:55:55 PM	[REDACTED]	[REDACTED]		\$1,266.00
10/07/2025 2:56:14 PM	[REDACTED]	[REDACTED]		\$1,315.50

Recommended/Deferred Services

Code	Description	Amount
HVAC	Hvac Repair- compressor assy with orings	
AC	Air Conditioning Recharge Service- \$249.00 plus Freon/ fees and taxes (R134A or 1234YF)	
WB	REPLACE WIPER BLADES \$14.30 rear	\$19.75
COOL	Coolant Service- \$189.00 plus shop fees and taxes (up to 8L of coolant) with Subaru coolant conditioner.	\$65.50
ENG	ENGINE REPAIR- headgaskets-full engine reseal with upper oil pan rh cam carrier, lh headgasket leaking, top of engine full of oil. **** monitor and keep eye on oil level****	\$847.76
DRIVE	Driveline Repair-RF AXLE ASSY with seal **** priority with leak****	\$936.49
SERVICED	SERVICE D- \$1189.00 Plus shop fees and taxes(H4 Engines) Oil & Filter Change, Rotate tires with Caliper Service, Inspect Tires & Adjust Pressures, Check Fluids, Lights, Wipers, Belts, Axle Boots, Service Battery, Lubricate Latches, Hinges and Locks, Inspect Steering and Suspension, Test Coolant, Inspect Hoses & Clamps, Replace Cabin & Engine Air Filter, Replace Transmission Fluid, Driveline Fluids, Spark Plugs, Check the Alignment & Road-test (if Alignment is needed, that is an additional 169.00)- Retorque tires in 100Km **** if not done yet, this would be a very good to do prior to winter hitting, important driveline oils due*****	\$661.37
ENG	ENGINE REPAIR- pcv	\$30.75
FUEL	Fuel Injection Service- \$269.00 plus shop supplies and taxes	\$81.00
BF	Brake Fluid Service- \$209.00 plus shop fees and taxes- complete brake fluid exchange **** do with Brake pad/ rotor replacement, if not done recently*****	\$32.00
YELLOWTIRE	YOUR TIRES ARE GETTING LOW ON TREAD, WILL SOON NEED TO BE REPLACED, PLEASE SEE QUOTE ATTACHED	
TIRE4	Mount and Balance 4 Tires- \$159.00 plus shop fee and taxes- Retorque lugs in 100 km, Free alignment check with brake measurements.	\$2,960.00



OUT	INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$ _____ BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS SERVICE INVOICE AND THE ACCOMPANYING WORK ORDER.
	DATE: _____ CUSTOMER SIGNATURE: _____



JF2SJAHC4FH454757

Odometer:280032

Subaru : Forester : 2015 ExpressAlign Total Alignment

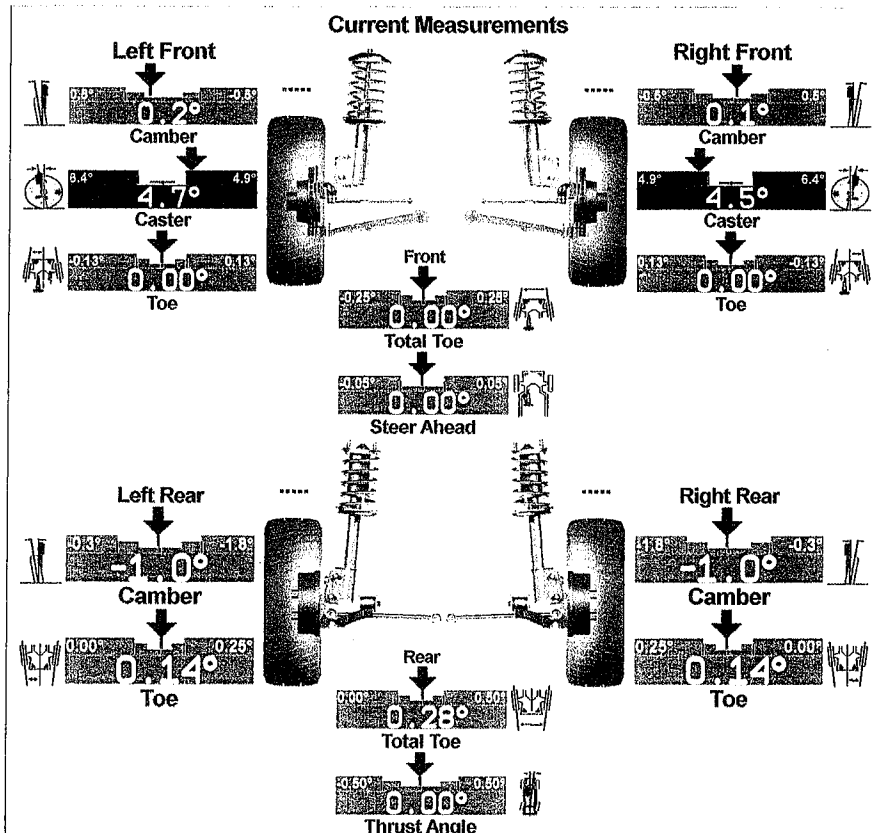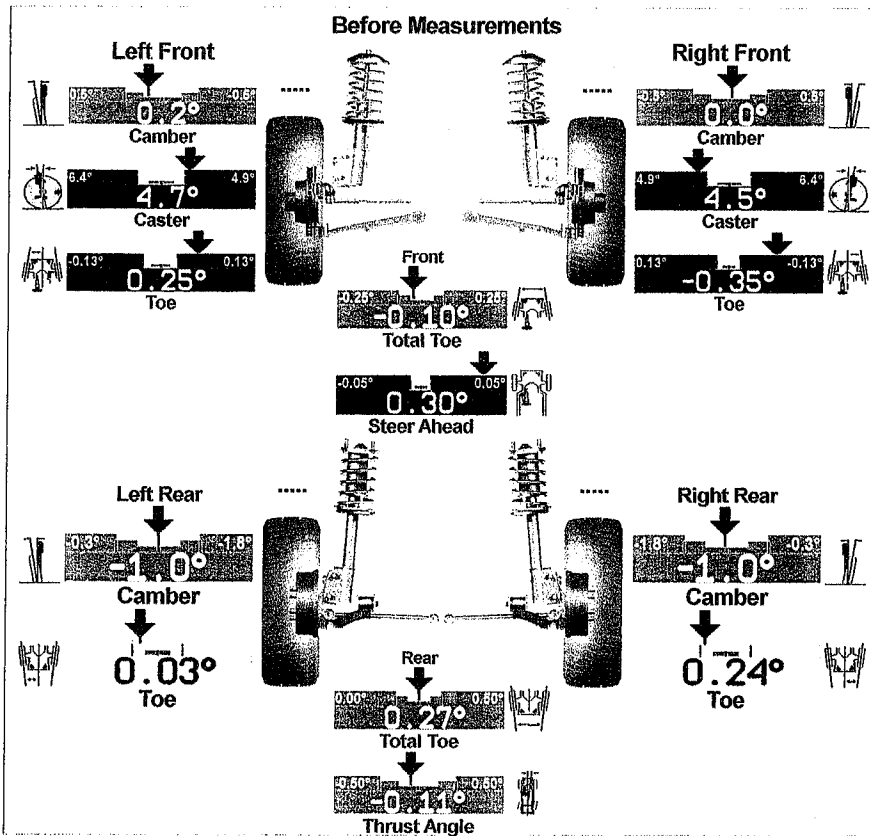

• One or more values are not within specification. Tire wear, handling and safety problems may result.



GOOSE
 5809 54th Ave
 Bonnyville, AB T9N 0C4
 (780) 201-4476
 service@goosemaintenance.com
 https://www.goosemaintenance.ca

Invoice for RO #27780

Service Advisor: Lisa Sargent
 Date Created: 12/15/25 at 04:47 PM MST
 Client: [REDACTED]
 Vehicle: 2015 Subaru Forester 2.5i Limited

[REDACTED]	2015 Subaru Forester 2.5i Limited 2.5L 4Cyl GAS FB25 Naturally Aspirated VIN: JF2SJAHC4FH454757 License: [REDACTED] Color: Blue Odometer In: 174887 / Out: 174887	RO # 27780
------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	------------

1 - Diagnose washer sprayers		
	<p>Diagnose washer sprayers- when you hit the front washers its spraying the rear, when you hit the rear activates the front</p> <p>Confirmed washers work different than designed. Checked body control module for input issues. Front and rear washer input reads properly when used. Suspect and connector or hose is swapped at pumps. Front hose is leaking in the cowl and rear wiper is inop.</p>	\$175.87
Labor:	<p>Removed left front tire and wheel well liner to access pumps. Found connectors are different so connectors swapped not possible Found hoses twisted and swapped inbetween mounting locations. Swapped hoses back and now washers work with proper input.</p> <p>Will require more time to access and repair leaking hose for front washers and diag rear wiper inop. Access and repair leaking hose for front washers</p> <p>Removed both wipers, removed Cowl panel, Found y fitting cracked and leaking. Replaced fitting and washers work well now.</p>	\$79.14
✓ Approved on 12/15/25 at 05:02 PM MST		Subtotal \$255.01 + est. Tax \$12.75 \$267.76

2 - Inspect Drive train		
	<p>Inspect Drive train- Ensure AWD is working properly customer thinks it feels like front wheel drive</p> <p>Took unit for test drive, confirmed unit only seems to be driving in FWD not AWD On hoist rear wheel want to turn a little but not a full revolution. No codes in system, Confirmed unit is in AWD mode as you can change this in the transmission control module. Found there is an AWD solenoid in the transmission valve body that engages AWD Found lock up duty cycle is actuation at 99% Transfer duty ratio is at 0% in all driving conditions Based on no electrical codes will have to research transmission operation and perform mechanical diagnosis on transmission. As AWD solenoid is in transmission On last road test - AWD light was flashing - scanned for codes - no codes in TCM or ECM</p>	\$175.87
Labor:		
✓ Approved on 12/15/25 at 05:02 PM MST		Subtotal \$175.87 + est. Tax \$8.79 \$184.66

RO Fees		
Fee:	Shop Supplies/Enviro	\$34.47
		Subtotal \$34.47

GST: 843630633 RC0001

Warning: wheel nuts require retorquing after 50 kilometers. Wheel nuts should be torqued to the manufacturer's specifications when tires have been removed for repair or replacement.

We offer a 2 year 50,000 km limited warranty on workmanship and parts. Vehicle must be brought back to the shop to honor warranty.

(Turbochargers come with 1yr Warranty for Parts & Labour)

No warranty on customer supplied parts

Storage fees are 35\$ per day after vehicle has not been picked up within 1 week of repair.

* If the vehicle invoice is not paid for after 90 days we have the right to sell the vehicle for the invoice amount.

Total Repair Order & Signature:

Total Jobs:	\$430.88
Total Fees:	\$34.47
Subtotal:	\$465.35
Taxes:	\$23.27
Grand Total:	\$488.62
BALANCE DUE:	\$0.00

X

✓ PAID

Completed Transactions					
12/17/25		\$488.62	Credit Card Payment		Chip Visa AID:A0000000031010

Declined Jobs:

1 - Diag rear wiper inop.			
X Declined on 12/17/25 at 09:08 AM MST	<i>Subtotal \$131.90 + est. Tax \$6.60</i>	\$138.50	
2 - Perform mechanical diagnosis on transmission. As AWD solenoid is in transmission			
X Declined on 12/17/25 at 10:38 AM MST	<i>Subtotal \$527.61 + est. Tax \$26.38</i>	\$553.99	

Canadian Tire Associate Store 0642
 PAUL VENTURA ENTERPRISES LTD.
 100-201 SOUTHRIDGE DR

Okotoks AB T1S 2C9
 Phone: 403-938-5719 Fax: 403-938-5899
 e-mail:

PAGE: 2
 DATE: Apr 04 24




INVOICE
10064200075774
 (Copy)

GST REG#: 8777141162
 PST REG#:

SOLD TO:



MOBILE :
 BUSINESS :
 EMAIL :



COLOUR	VEHICLE DESCRIPTION	PLATE	UNIT#	TAG	ODO IN	
	2015 SUBARU FORESTER 4-2498 2.5L DOHC				0	
VIN	VEHICLE OPTIONS				ADV	ODO AUTH
					ss01	0
TIME IN	PROMISED	TERMS	GST EXEMPT#	P.O.	ODO OUT	
3:44 PM		Cash			0	

QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE
		Corporate Customer Relations at 1-866-846-5841 or via email at https://www.ctfs.com/ContactUs/ . ***Tire Storage Terms*** Storage term: (applicable only to customers who have purchased tire storage) Tires will be stored up to a maximum of 8 months from Invoice date OR until customer requests to have Tires removed from the storage location for any reason, at which point the storage term will end. Canadian Tire is not responsible for unclaimed tires at expiration of storage term. Tires left beyond 30 days of term expiration date will be disposed of without any liability or obligation to customer. Payment for Tire Storage is deemed to be acceptance of these terms by customer.			

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.

Customer Signature: _____

PARTS:	205.99
LABOUR:	N/C
OTHER:	N/C
SUB-TOTAL:	205.99
GST/HST:	10.30
PST:	N/C
TOTAL:	216.29

All Toys & Trucks

UNLOCK YOUR IMAGINATION



Invoice

75 9 Ave SE
 High River, AB
 T1V 1E7
 403-601-2663 alltoys@shaw.ca

Date	Invoice #
5/7/2024	42100



Invoice To
[REDACTED]

VIN	Vehicle	Mileage
	2015 Forester	153750

Qty	Description	Rate	Amount
1	Rear brake pads	157.59	157.59
2	Resurface brake rotors	30.00	60.00
1	RT headlight bulb	15.79	15.79
1.4	Labour	124.00	173.60
	GST On Sales	5.00%	20.35
		Subtotal	\$406.98
Signature:		GST	\$20.35
Your wheels have been torqued. Retorque is required in 100 kms.		Total	\$427.33

All Toys & Trucks

UNLOCK YOUR IMAGINATION

75 9 Ave SE
 High River, AB
 T1V 1E7
 403-601-2663 alltoys@shaw.ca

Invoice

Date	Invoice #
11/22/2024	43848



Invoice To
[REDACTED]

Vehicle	Mileage
2015 Forester	162349

Qty	Description	Rate	Amount
1	Oil filter	14.95	14.95
4.8	0W20 synthetic oil	15.95	76.56
0.3	Labour	124.00	37.20
4	Mount & balance	40.95	163.80
	GST On Sales	5.00%	14.63
There is no warranty implied on customer supplied parts.			
Subtotal			\$292.51
Signature:			GST \$14.63
Your wheels have been torqued. Retorque is required in 100 kms.			Total \$307.14




speedyglass.ca



87710000579328

HYLTON INVESTMENTS LTD
220 Stockton Ave Unit 104
Okotoks AB T1S 1B7
(403) 938-3892 Fax: (403) 938-0673

Invoice
8771 - 5793281
Date : 8/21/2024



JOB ID : 87710000579328

Vehicle : 2014 Subaru Forester 4 Door Utility
Appointment Date :

V.I.N : NA
Odometer :

<u>Products & Services</u>	<u>Description</u>	<u>Qty</u>	<u>Labour</u>	<u>Material</u>
FW03741GTN	2014+ SUBARU FORESTER	1	0.00	318.00
USMF3741	3/4 UNDERSIDE MLDG FW3741-3742	1	0.00	45.00
KIT2	URETHANE	1	0.00	0.00
DISPO	DISPOSAL FEE	1	0.00	0.00

GST/HST# : 849257084RT
PST/TVP# :

Material :	363.00
Labour :	0.00
Sub-Total :	363.00
GST/HST (5%) :	18.15
PST/TVP (0%) :	0.00
Total :	381.15
TOTAL PAYABLE BY CUSTOMER :	381.15
Deposit paid :	0.00
Visa :	-381.15
Balance :	0.00

I recognize having read the details of this invoice, the sale conditions and warranties on the last page of the present invoice. For your insurance claim (if applicable), you also recognized having provided us with your consent for us to collect, use and disclose your personal information, to obtain other specific information relating to the incident that caused the glass damage and forward such information to the insurer indicated on this invoice for investigation, processing and claim settlement purposes.

Customer Signature: _____

Date _____

The adhesive that we use to attach the windshield to the body takes time to set. In order to allow the adhesive to set sufficiently before driving your vehicle, please follow the instructions below:




speedyglass.ca



87710000579328

HYLTON INVESTMENTS LTD
220 Stockton Ave Unit 104
Okotoks AB T1S 1B7
(403) 938-3892 Fax: (403) 938-0673

Invoice
8771 - 5793281
Date : 8/21/2024



1. Minimum drive-away time; vehicle should not be driven for at least 1hr after installation completed unless technician has stated, in the space below, that a different minimum drive-away time applies.

DO NOT DRIVE THE VEHICLE BEFORE: 10:00

2. After the installation, you should not do anything that could interfere with the adhesive setting process such as pushing against, touching or otherwise testing the glass or adhesive.

3. You should not take the vehicle through a car wash for first 24hours after installation. If these instructions are not followed, adhesive might not set or retain glass sufficiently, which could cause accident or damage to vehicle, or increase the risk of injury if vehicle is involved in a collision.

WINDSHIELD INSTALLATION: The warranty is not transferable or redeemable for cash, the installation is warranted against leaks and windshield manufacturing defects. (See reverse.)



87710000579328

SALES CONDITIONS AND WARRANTIES

Authorization

I hereby authorize the work and/or purchase of goods and services referred to on this invoice and agree to pay the total amount referred to herein. Where the work and/or goods and services are covered by an insurance policy, I authorize the Supplier for and on my behalf, to seek the full payment of the amount referred to under "Amount payable by insurer" directly to my insurance company or its authorized representative. I agree that this request for payment is made by Supplier only to accommodate me and in the event that my insurance company or its representative fails to authorize payment of such amount, I agree to pay any unpaid residual amount. Ownership of the goods sold referred to on this invoice remains with Supplier until full payment of this invoice. I agree to pay interest at 1.5% per month (18% per annum) on overdue accounts.

Insurance Declaration

I declare the information contained herein to be true and correct to the best of my knowledge and that the loss or damage did not occur through any willful act, procurement means, or connivance of the undersigned and that the repair or replacement has been completed to my entire satisfaction and hereby authorize my insurance company to make payment directly to Supplier in full settlement of its obligations under my policy for said claim.

Credit Card Authorization

The issuer of the card identified herein is authorized to pay the amount shown as total upon proper presentation. I promise to pay such total (together with any other charges due thereon) subject to and in accordance with the agreement governing the use of such card.

Warranty Conditions

Subject to the following terms and conditions, this warranty will be honored at all Supplier locations throughout Canada.

Once the invoice is paid in full, Supplier guarantees the work done by its technicians for life:

-Windshield replacements are guaranteed against installation and manufacturing defects and leaks. If such defect occurs, we will provide and install the necessary parts free of charge.

-Tempered glass windows are guaranteed for one (1) year against manufacturing defects.

-If a chip cracks after we have repaired it, we will deduct the cost of the repair from the windshield replacement done by us.

-The recalibration made during your windshield replacement is guaranteed for one (1) year or until the next recalibration event (as determined by the vehicle manufacturer), whichever occurs first.

HOWEVER, SUPPLIER SHALL NOT BE LIABLE FOR ANY DAMAGES OR DEFECTS CAUSED BY:

-IMPROPER USE, NEGLIGENCE, ALTERATION, ACCIDENT, INTERNATIONAL ACTS, INCIDENT OR ROAD HAZARD,

-INADEQUATE REPAIR ATTEMPTED OR PERFORMED BY THE CONSUMER OR ANY THIRD PARTY, OR

-USE OF THE VEHICLE FOR COMPETITIVE PURPOSES.

Where any automobile glass or purchased products fail due to defects in material or workmanship during normal usage during the warranty period specified herein, Supplier shall repair or replace the defective part without charge. If Supplier is unable to make the repair or replacement, Supplier will refund the original purchase price of your warranted product.

To obtain a warranty repair, you must take your vehicle to a Supplier location together with a copy of the original Supplier invoice as proof of purchase and of the warranty certificate. All claims under this warranty must be reviewed for eligibility by a member of the Supplier team. NO REFUNDS OR CREDITS WILL BE GRANTED FOR ANY WORK OR REPAIRS DONE BY THE CONSUMER OR ANY THIRD PARTIES.

Supplier warranties apply only to complete and proper installation and repair. WARRANTIES MAY BE REDUCED OR WITHDRAWN WHEN CUSTOMERS ELECT INCOMPLETE OR IMPROPER INSTALLATION (such as installation over rusting metal, where the customer declined rust repair). Such details will be noted on the front of the invoice. ALL SEALANT WARRANTIES EXCLUDE LIABILITY WHERE LEAKS ARE CAUSED BY RUSTED METAL AND/OR BODY DETERIORATION. This warranty does not cover leakage due to deterioration of the vehicle's bodywork or damage caused by vandalism, theft, natural disaster, unlawful activity, or willful act.

To the extent permitted by law, Supplier's warranty is non-transferable and becomes null and void upon a change in ownership of the vehicle repaired or the product purchased.

Limitations of Liability

THE WARRANTIES DESCRIBED ON THIS INVOICE ARE IN LIEU OF ALL OTHER WARRANTIES OR CONDITIONS, EXPRESS OR IMPLIED, WRITTEN OR VERBAL. SUPPLIER SHALL NOT BE LIABLE TO THE PURCHASER FOR ANY CLAIMS REGARDING FAILURE OR DEFECT OF THE PURCHASED GOODS OR SERVICES RESULTING IN DIRECT OR INDIRECT, INCIDENTAL OR CONSEQUENTIAL, LOSS OR DAMAGES, PERSONAL INJURY OR DEATH. IN NO CASE SHALL THE LIABILITY OF SUPPLIER EXCEED THE PURCHASE PRICE PAID FOR THE GOODS BY THE PURCHASER.

Some provinces do not allow the exclusion or limitation of a warranty or of incidental or consequential damages, so the above limitations and exclusions may not apply to you. This warranty gives you specific legal rights and you may also have additional rights, which vary from province to province. The terms and conditions contained herein do not limit or otherwise diminish any rights to which you may be entitled under consumer protection legislation in any province.

Version française disponible sur demande.

Canadian Tire Associate Store 0642
 PAUL VENTURA ENTERPRISES LTD.
 100-201 SOUTHRIDGE DR

Okotoks AB T1S 2C9
 Phone: 403-938-5719 Fax: 403-938-5899
 e-mail:

PAGE: 1
 DATE: Apr 04 24



INVOICE
10064200075774
 (Copy)

GST REG#: 8777141162
 PST REG#:

SOLD TO:



MOBILE
 BUSINESS
 EMAIL



COLOUR	VEHICLE DESCRIPTION	PLATE	UNIT#	TAG	ODO IN
	2015 SUBARU FORESTER 4-2498 2.5L DOHC				0
VIN	VEHICLE OPTIONS			ADV	ODO AUTH
				ss01	0
TIME IN	PROMISED	TERMS	GST EXEMPT#	P.O.	ODO OUT
3:44 PM		Cash			0

QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE
1	0103585	MotoMaster OEP35 AUT.BAT MOTOMASTER OEPLUS Group Size 35 Battery, 640 CCA Location: 9BAT01-1-Y-Battery Rack Sect 01 Battery S/N(1): 7912027	M1	185.99	185.99
1	XCORE	Core Charge 0103585 MotoMaster OEP35 AUT.BAT MOTOMASTER OEPLUS Group Size 35 Battery, 640 CCA PLEASE HAVE YOUR LUG NUTS RETORQUED AFTER 100 KM. PLEASE VISIT US AT WWW.TELLCDNTIRE.COM AND FILL OUT A QUICK SURVEY. YOUR FEEDBACK IS IMPORTANT TO US *** Warranty Code Legend *** M1: See Service Manager for details *** Global Warranty Message *** Installed parts warranties applicable only when product is installed at a Canadian Tire Automotive Service Centre, otherwise warranties may vary. Warranty not available for commercial use. A minimum labour warranty of 100 days / 5500 km applies to installed parts unless otherwise stated above. Installed parts warranty starts on the completion date shown on the customer invoice. Please see auto parts staff for cash & carry parts warranties. ***Wheel Retorque*** Canadian Tire checks every tire after installation and retorques to the manufacturer's recommended values. It is recommended to have your wheels retorqued after driving for a short distance to account for any settling that can happen from continuous contact with the road. For added protection, kindly return to this location for a free wheel retorque after driving your vehicle between 50km and 100km. ***PRIVACY TERMS*** Canadian Tire Corporation, Limited, its affiliates, Associate Dealers, and service providers ("CTC" or "our") collect and use the personal information provided by you to fulfill this contract. CTC may also collect and use your information to administer the delivery of and market warranties, products, services, and loyalty programs to you, and to analyze your relationship with us. Please visit www.canadiantire.ca for details on CTC's privacy policy. If you do not wish for your information to be kept in our database, please contact CTC's		20.00	20.00

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.
 Customer Signature: _____

PARTS:	
LABOUR:	
OTHER:	
SUB-TOTAL:	
GST/HST:	
PST:	
TOTAL:	Cont'd

All Toys & Trucks

UNLOCK YOUR IMAGINATION

75 9 Ave SE
 High River, AB
 T1V 1E7
 403-601-2663 alltoys@shaw.ca



Invoice

Date	Invoice #
10/18/2023	40616



Invoice To
[REDACTED]

VIN:	Vehicle	Mileage
	2015 Forester	148106

Qty	Description	Rate	Amount
1	Oil filter	13.95	13.95
4.8	0W20 synthetic oil	15.95	76.56
0.3	Labour	124.00	37.20
	GST On Sales	5.00%	6.39
		Subtotal	\$127.71
Signature:		GST	\$6.39
Your wheels have been torqued. Retorque is required in 100 kms.		Total	\$134.10



75 9 Ave SE
High River, AB
T1V 1E7
403-601-2663 alltoys@shaw.ca



Invoice

Date	Invoice #
1/16/2023	38426



Invoice To
Cash Customer

Vehicle	Mileage
2014 Subaru	138098

Qty	Description	Rate	Amount
1	Oil filter	13.95	13.95
4.8	0W20 synthetic oil	15.95	76.56
0.25	Labour	119.00	29.75
	GST On Sales	5.00%	6.01
		Subtotal	\$120.26
Signature:		GST	\$6.01
Your wheels have been torqued. Retorque is required in 100 kms.		Total	\$126.27



MEMBER FINAL INVOICE

Date: 5/24/23 Invoice #: 10690132255
Time In: 9:32:53 Time Out: 10:36:18
Membership #: [REDACTED]

MEMBER INFORMATION	VEHICLE INFORMATION
[REDACTED]	2015 Subaru Forester 2.5i Convenien Colour: GREY License: [REDACTED] Odometer: 142513 Wheel Torque: 89 TPMS Service Pack#: VS950 Air Pressure: Front: 30 Rear: 29

ITEM#	DESCRIPTION	Qty
1662858	BS WEATHERPEAK 110,000 KM WARRANTY 225/60R17 99 H BW 9645 Nitrogen inflation	4
6850	Tire Installation	4
504595	Nitrogen Tire Inflation Keep Old Tires	4

Member should return for
Torque Verification after 4000 KMS
Initial: _____

I acknowledge my lock key
was returned by Costco Okotoks
Initial: _____

143082 ml

E-COMMERCE ORDER

17X41WP011423 17X41WP011423 17X41WP011423 17X41WP011423

NOTES:

See Additional Notes...

*Inflation and Torque specifications are recommended by Manufacturer.

N X	N X
N X	N X

to Spare
 Dynamic
 WhiteWall

MIRANDA
Sales Person

WILLEM BERNARD
10-Point Vehicle Release




Date: 5/24/23 Invoice #: 10690132255
Time In: 9:32:53 Time Out: 10:36:18

ADDITIONAL NOTES

- * To Access your Bridgestone Tire Warranty Information, and to register the DOT numbers for new tires purchased, visit the links below.
- * Bridgestone Tire DOT Registration Web Address - <https://www.bridgestonetire.ca/customer-care/tire-registration>
- * Bridgestone Tire Warranty Information Web Address - <https://www.bridgestonetire.com/customer-care/tire-warranties>
- * WARRANTY NOTICE - All tire warranties have limits. Depending on the type of tire warranty and or tire manufacturer, tire warranties can range from 4 to 6 years and other limits may apply. Please speak with a Costco Tire Sales Associate if you need assistance with a tire warranty.
- * Follow the direction in your vehicle's owner's manual for rotation and rebalance intervals . In the absence of direction in your vehicle's owner's manual, rotate and rebalance your tires every 7,500 MILES or 12,000 KM.
- * Your tires are inflated with nitrogen. Nitrogen stabilizes a tire's inflation pressure more efficiently than regular air. If needed, air and nitrogen may be mixed; return to any Costco for purge and refill to the proper nitrogen purity level if air and nitrogen are mixed. There are no safety concerns with mixing air and nitrogen.
- * Tire rotation patterns may be limited if a tread depth difference of more than 2/32nds of an inch is present between the front and rear tires of a vehicle.
- * Read and follow all tire maintenance requirements outlined in the Tire Manufacturers' Warranty booklet provided at the time of purchase by hard copy or by reference to the Manufacturer's website.
- * lock to desk winters in car

MEMBER PURCHASE INVOICE



MEMBER INFORMATION	VEHICLE INFORMATION
	2015 Subaru Forester 2.5i Convenien Colour: GREY License: Odometer: Wheel Torque: 89 Air Pressure: Front: 30 Rear: 29



ITEM#	DESCRIPTION	Qty	SLIP PRINT
1662858	BS WEATHERPEAK 110,000 KM WARRANTY 225/60R17 99 H BW 9645 Nitrogen inflation	4	
6850	Tire Installation	4	
504595	Nitrogen Tire Inflation	4	
	Keep Old Tires	4	

E-COMMERCE ORDER

NOTES:

See Additional Notes...

*Inflation and Torque specifications are recommended by Manufacturer.

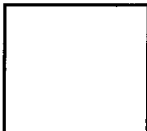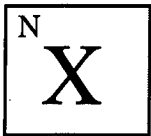

- Best to Spare
- Static Dynamic
- Blackwall Whitewall

MIRANDA
 Sales Person



Date: 05/24/23 Invoice #: 10690132255
Time In: 9:32:53

ADDITIONAL NOTES



- * To Access your Bridgestone Tire Warranty Information, and to register the DOT numbers for new tires purchased, visit the links below.
- * Bridgestone Tire DOT Registration Web Address - <https://www.bridgestonetire.ca/customer-care/tire-registration>
- * Bridgestone Tire Warranty Information Web Address - <https://www.bridgestonetire.com/customer-care/tire-warranties>
- * WARRANTY NOTICE - All tire warranties have limits. Depending on the type of tire warranty and or tire manufacturer, tire warranties can range from 4 to 6 years and other limits may apply. Please speak with a Costco Tire Sales Associate if you need assistance with a tire warranty.
- * Read and follow all tire maintenance requirements outlined in the Tire Manufacturers' Warranty booklet provided at the time of purchase by hard copy or by reference to the Manufacturer's website.



UNLOCK YOUR IMAGINATION

75 9 Ave SE
High River, AB
T1V 1E7
403-601-2663 alltoys@shaw.ca

Invoice

Date	Invoice #
3/29/2022	36203



Invoice To
Cash Customer

Vehicle	Mileage
2015 Forester	127322

Qty	Description	Rate	Amount
1	Oil filter	11.95	11.95
4.8	0W20 synthetic oil	14.95	71.76
0.25	Labour	113.00	28.25
	GST On Sales	5.00%	5.60
		Subtotal	\$111.96
Signature:		GST	\$5.60
Your wheels have been torqued. Retorque is required in 100 kms.		Total	\$117.56



Canadian Tire Associate Store 0642
 PAUL VENTURA ENTERPRISES LTD.
 100-201 SOUTHRIDGE DR


Okotoks AB T1S 2C9
 Phone: 403-938-5719 Fax: 403-938-5899
 e-mail: ctservice642@gmail.com

PAGE: 1
 DATE: Oct 23 22



INVOICE
20064200077137

GST REG#: 8777141162
 PST REG#:



COLOUR	VEHICLE DESCRIPTION		PLATE	UNIT#	TAG	ODO IN
GREY	2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC					134831
VIN	VEHICLE OPTIONS				ADV	ODO AUTH
JF2SJAHC4FH454757					TA01	134831
TIME IN	PROMISED	TERMS	GST EXEMPT#		P.O.	ODO OUT
9:00 AM		Cash				134831

QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE
4	tr034	Install Customer Supplied Tires PK01 Oct 23 22 WHEEL LOCK KEYS LOCATION? WHITE WALLS / LETTERING (INSIDE / OUTSIDE) THERE IS A \$10.00 SURCHARGE FOR TIRES 18" AND OVER OR LOW PRO SERIES 45 AND BELOW CUSTOMER REQUESTED A WRITTEN ESTIMATE: YES ___ NO <u>X</u> AUTHORIZATION WAS OBTAINED BY: TEXT ___ EMAIL ___ IN PERSON <u>X</u> PHONE ___ NAME OF THE CONTACT PERSON WHO AUTHORIZED THE WORK: <u>MARIANA</u> DATE AND TIME THE AUTHORIZATION WAS COMMUNICATED: <u>10/23/22</u> CUSTOMER DECLINED OLD PARTS: YES ___ NO <u>X</u>		35.00	140.00
1	TEXTSWAP10	Save \$10 on an on rim tire changeover		10.00-	10.00-
1	SS	Shop Supplies Authorized on: Oct 23 2022 PLEASE HAVE YOUR LUG NUTS RETORQUED AFTER 100 KM. PLEASE VISIT US AT WWW.TELLCDNTIRE.COM AND FILL OUT A QUICK SURVEY. YOUR FEEDBACK IS IMPORTANT TO US *** Global Warranty Message *** Installed parts warranties applicable only when product is installed at a Canadian Tire Automotive Service Centre, otherwise warranties may vary. Warranty not available for commercial use. A minimum labour warranty of 100 days / 5500 km applies to installed parts unless otherwise stated above. Installed		9.80	9.80

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.

Customer Signature: _____

PARTS:	
LABOUR:	
OTHER:	
SUB-TOTAL:	
GST/HST:	
PST:	
TOTAL:	Cont'd



Canadian Tire Associate Store 0642
 PAUL VENTURA ENTERPRISES LTD.
 100-201 SOUTHRIDGE DR


Okotoks AB T1S 2C9
 Phone: 403-938-5719 Fax: 403-938-5899
 e-mail: ctservice642@gmail.com

PAGE: 2
 DATE: Oct 23 22



INVOICE
20064200077137

GST REG#: 8777141162
 PST REG#:



MOBILE
 BUSINESS
 EMAIL

COLOUR	VEHICLE DESCRIPTION	PLATE	UNIT#	TAG	ODO IN
GREY	2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC				134831
VIN	VEHICLE OPTIONS			ADV	ODO AUTH
JF2SJAHC4FH454757				TA01	134831
TIME IN	PROMISED	TERMS	GST EXEMPT#	P.O.	ODO OUT
9:00 AM		Cash			134831


QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE
		parts warranty starts on the completion date shown on the customer invoice. Please see auto parts staff for cash & carry parts warranties. ***PRIVACY TERMS*** Canadian Tire Corporation, Limited, its affiliates, Associate Dealers, and service providers ("CTC" or "our") collect and use the personal information provided by you to fulfill this contract. CTC may also collect and use your information to administer the delivery of and market warranties, products, services, and loyalty programs to you, and to analyze your relationship with us. Please visit www.canadiantire.ca for details on CTC's privacy policy. If you do not wish for your information to be kept in our database, please contact CTC's Corporate Customer Relations at 1-866-846-5841 or via email at https://www.ctfs.com/ContactUs/ . ***Tire Storage Terms*** Storage term: (applicable only to customers who have purchased tire storage) Tires will be stored up to a maximum of 8 months from Invoice date OR until customer requests to have Tires removed from the storage location for any reason, at which point the storage term will end. Canadian Tire is not responsible for unclaimed tires at expiration of storage term. Tires left beyond 30 days of term expiration date will be disposed of without any liability or obligation to customer. Payment for Tire Storage is deemed to be acceptance of these terms by customer.			

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.

Customer Signature: _____

PARTS:	N/C
LABOUR:	140.00
OTHER:	.20
SUB-TOTAL:	139.80
GST/HST:	6.99
PST:	N/C
TOTAL:	146.79



3819 MACLEOD TRAIL SOUTH
CALGARY, ALBERTA T2G 2R3

PHONE: (403) 287-2544
FAX: (403) 243-1277
TOLL FREE 1-800-668-3128
www.centaursubaru.ca


CENTAUR | SUBARU
SO # 420572

**SERVICE ORDER
CUSTOMER COPY**



Printed 04/15/2021 11:11:47 AM

User SNB Page 2

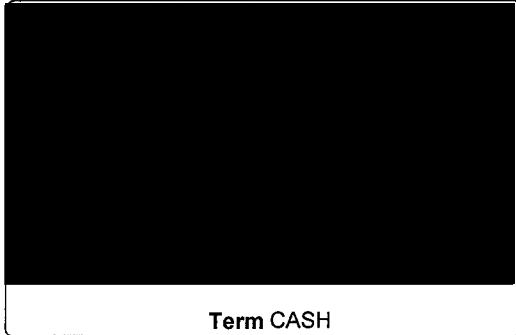

Term CASH

Advisor	STEFFAN	Promised	04/15/2021 5:30 PM	Tag
Shop	S1	Opened	04/15/2021 8:01 AM	Location
Priority		Cashiered	04/15/2021 11:11 AM	PO #

License No	Odometer In	Odometer Out	InServ Date	Stock No
	112054	112056		
Year	Make	Model	Model No	Colour
2015	SUBARU	FORESTER	FFI	1K DARK GREY
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
JF2SJAHC4FH454757				
Engine Size	2.5L 4 Cyl DOHC 16V w/VVT -inc:	Fleet #		


YOU CAN NOW BOOK YOUR NEXT SERVICE ON LINE AT
WWW.CENTAURSUBARU.CA AND IF YOU HAVE ANY COMMENTS
OR CONCERNS, PLEASE CONTACT TODD PHILIPS AT 287-2544

Labour	844.99
Parts	542.20
Supplies	25.00
SUB-TOTAL	1,412.19
GST	70.61
TOTAL INVOICE	1,482.80

PRIVACY NOTICE

I have read the Privacy Notice on the back of this document.
 By checking this box, I consent to receiving marketing updates and information regarding products and services from Dealer and/or Dealer's Parent Organization.
Customer Signature: _____ Date: _____

INDEBTEDNESS IS HEREBY ACKNOWLEDGED FOR THE AMOUNT INDICATED ON THIS INVOICE FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE. 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.
GST # R100867001
*Thank You
for your
business*



3819 MACLEOD TRAIL SOUTH
CALGARY, ALBERTA T2G 2R3

PHONE: (403) 287-2544
FAX: (403) 243-1277
TOLL FREE 1-800-668-3128
www centaursubaru.ca


CENTAUR | SUBARU
SO # 420572

SERVICE ORDER
CUSTOMER COPY



Printed 04/15/2021 11:11:46 AM

User SNB Page 1



Term CASH

Advisor	STEFFAN	Promised	04/15/2021 5:30 PM	Tag
Shop	S1	Opened	04/15/2021 8:01 AM	Location
Priority		Cashiered	04/15/2021 11:11 AM	PO #

License No	Odometer In	Odometer Out	InServ Date	Stock No
	112054	112056		
Year	Make	Model	Model No	Colour
2015	SUBARU	FORESTER	FFI	1K DARK GREY
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
JF2SJAHC4FH454757				
Engine Size	2.5L 4 Cyl DOHC 16V w/VVT -inc:	Fleet #		

Request	Description	Job	CSR	Status
200D	200,000KM D SERVICE - \$1300	1	50	Original

Labour	Description	Type	Hours	Amount
200D	200,000 KM D SERVICE/INSPECTION COMPLETED - OIL CHANGED - ROTATED AND INSPECTED TIRES - SERVICED FRONT AND REAR BRAKES - FRONT BRAKES AT 5MM - REAR BRAKES AT 5MM - TIRE TREADS AT 6/32 - TOPPED UP ALL FLUIDS - TESTED BATTERY - INSPECTED/REPLACED AIR/CABIN FILTERS - REPLACED SPARK PLUGS - COMPLETED INJECTOR SERVICE - REPLACED TRANSMISSION FLUID - REPLACED DIFFERENTIAL FLUIDS - CHECKED ALIGNMENT - SET ALL TIRE PRESSURES - LUBRICATED ALL LOCKS AND HINGES - SEE ATTACHED REPORT FOR DETAILS	CP	5.50	715.00
CALIGN	FOUND WHEELS OUT OF ALIGNMENT - CORRECTED	CPM	1.50	129.99
BALANCE	FOUND WHEELS OUT OF BALANCE - CORRECTED	CPM	0.30	0.00
100	FOUND LEFT FOGLAMPS OUT - REPLACED	CP	0.00	0.00
100	REPLACED TORN FRONT WIPER BLADES - REAR WIPER STUCK	CP	0.00	0.00

Part	Description	Req	Bin	Type	Price	Amount
EHC123	ENVIRONMENTAL CHARGE	1	SHOP	CRO	0.50	0.50
EHC0456	ENVIRONMENTAL CHARGE	6	SHOP	CRO	0.05	0.30
SCI800168	BULK 0W20 SUPER 3000 MOBIL,1 L	6	SHOP	CRO	8.02	48.12
15208AA15A	OIL FILTER 2013 2.5 LEG/OBK	1	M8	CRO	10.95	10.95
803916010	*GASKET OIL PAN	1	DR1	CRO	2.33	2.33
72880FJ000	FILTER, CABIN	1	M2	CRO	45.05	45.05
16546AA12A	ELEMENT AIR CLNR	1	M2	CRO	32.95	32.95
22401AA781	PLUG-SPARK	4	M2	CRO	29.65	118.60
103161	MOBIL DELVAC 75W90 SYNTHETIC GEAR OIL	2	SHOP	CRO	13.35	26.70
EHC0456	ENVIRONMENTAL CHARGE	2	SHOP	CRO	0.05	0.10
SCI810012WR	CVTF-II FLUID 1L FOR WARR ONLY	7	SHOP	CRO	25.06	175.42
EHC0456	ENVIRONMENTAL CHARGE	7	SHOP	CRO	0.05	0.35
803926090	GSKT-26.3X32.3X1	7	DR1	CRO	3.50	24.50
600261	26" wiper blade	1	BR	CRO	21.79	21.79
600171	17" WIPER BLADE	1	BR	CRO	12.59	12.59
84920AJ010	BULB FE)	1	B8	CRO	21.95	21.95

Technician 12 - TREVOR

Parts Total	542.20
Labour Total	844.99
Request Total	1,387.19

PRIVACY NOTICE

I have read the Privacy Notice on the back of this document.
 By checking this box, I consent to receiving marketing updates and information regarding products and services from Dealer and/or Dealer's Parent Organization.
 Customer Signature: _____ Date: _____

INDEBTEDNESS IS HEREBY ACKNOWLEDGED FOR THE AMOUNT INDICATED ON THIS INVOICE FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE. 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS. GST # R100867001

*Thank You
for your
business*

CENTAUR SUBARU
 3819 Macleod Trail
 Calgary Alberta
 T2G 2R3
 Phone # 403-287-2544

Name _____
 Address _____
 Telephone _____
 Vehicle (VIN) _____
 License _____
 Mileage _____
 Technician _____ Date _____

Subaru 14 - 15 Forester

Left Front					Right Front			
Actual	Before	Specified Range			Actual	Before	Specified Range	
-0°12'	-0°47'	-0°30'	0°30'	Camber	0°04'	0°03'	-0°30'	0°30'
.....	4°55'	6°25'	Caster	4°55'	6°25'
-0°01'	-0°41'	-0°08'	0°08'	Toe	0°01'	-0°00'	-0°08'	0°08'
.....	SAI
.....	Included Angle
.....	Turning Angle Diff.

	Front			
	Actual	Before	Specified Range	
Cross Camber	0°18'	-0°49'	-0°35'	0°36'
Cross Caster
Total Toe	0°00'	0°41'	-0°15'	0°15'

Left Rear					Right Rear			
Actual	Before	Specified Range			Actual	Before	Specified Range	
-1°01'	-1°03'	-1°45'	-0°15'	Camber	-0°52'	-0°55'	-1°45'	-0°15'
0°11'	0°11'	0°00'	0°15'	Toe	0°09'	-0°05'	0°00'	0°15'

	Rear			
	Actual	Before	Specified Range	
Total Toe	0°21'	0°06'	0°00'	0°30'
Thrust Angle	0.02°	0.13°	-0.50°	0.50°

CUSTOMER #:



160882

SUBARU
CALGARY



INVOICE

1100 Meridian Road NE, Calgary, Alberta T2A 2N9

PAGE 1

Toll-free 1.888.722.6422 • subaruocalgary.com

T 403.571.3072 • F 403.571.3070

SERVICE ADVISOR: 2877 KEN BAKER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
GREY	15	SUBARU FORESTER	JF2SJAHC4FH454757		104316/104316	T563	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN15 IS							
01JAN15 DD			16:00 10NOV20			CASH	10NOV20
R.O. OPENED	READY	OPTIONS: DLR:C.E.M.C. ENG:2.5_Liter					
08:26 10NOV20	15:48 10NOV20						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A C/S: CUST REPORT REPORT LACK OF POWER AT HIGH WAY SPEED CUST HAS TO SHUT THE VEH OF / MULTIPLE LIGHT DISPLAYED ON DASH ABS / CEL. PLEASE CHECK AND ADVISE PDT CHECK FOR CONCERN

25	CPSU					149.95	149.95
PARTS:	0.00	LABOR:	149.95	OTHER:	0.00	TOTAL LINE A:	149.95

NO LIGHTS ON DASH ON START UP. DROVE VEHICLE INTO SHOP. UNABLE TO DRIVE VEHICLE AT HIGHWAYS SPEEDS DUE TO LOW TREAD ALL SEASON TIRES AND ROAD CONDITIONS.

SCANNED VEHICLE FOUND HISTORY CODES:
P0971, B1101, B1102, C2543, C1431, C1532, C2521, AND COMMUNICATION CODES U0073, U0164, U1201.
UPDATED ECM FROM OLD FLASH PART NUMBER 22765AG751 TO NEW FLASH PART NUMBER 22765AG754.
CUSTOMER TO MONITOR.

B MULTI-POINT VEHICLE INSPECTION
30POINT COMPLETE SUBARU 30 POINT INSPECTION
REPORT

25	IOSU					(N/C)	
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE B:	0.00

COMPLETED MULTI POINT INSPECTION. INSPECTED ALL FLUIDS, ENGINE/ CABIN AIR FILTERS, BRAKES, TIRE CONDITION, DRIVELINE COMPONENTS AND ADJUSTED TIRE PRESSURES TO SPECIFICATION.
ALL SEASON TIRES ARE AT 5/32NDS. AT 4/32NDS TIRES ARE UNSAFE FOR WINTER ROAD CONDITIONS. RECOMMEND REPLACEMENT OF ALL SEASON TIRES WITH WINTER TIRES. RECOMMEND ALIGNMENT IN CONJUNCTION WITH TIRES TO PROMOTE EVEN TREAD WEAR.

C SUBARU RECALL CHECK - DCS INQUIRY PERFORMED FOR OUTSTANDING RECALLS AND CONFIRMATION OF IN SERVICE DATE AND WARRANTY STATUS
SRCC SUBARU RECALL CHECK - DCS INQUIRY PERFORMED

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.	TERMS: STRICTLY CASH UNLESS ARRANGEMENT MADE	DESCRIPTION	TOTALS
	2% PER MONTH (24% PER ANNUM) MAY BE CHARGED ON OVERDUE ACCOUNTS	LABOR AMOUNT	
	I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, or any other cause beyond your control or for any delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledge on above vehicle to secure the amount of repairs thereto.	PARTS AMOUNT	
	I hereby acknowledge my indebtedness in the amount of \$ _____ being the total amount owing, or balance owing for repairs, parts & accessories describe in this work order.	GAS, OIL, LUBE	
	GST # R101134690	SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		LESS INSURANCE	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

X

CUSTOMER #: [REDACTED]

160882

SUBARU
CALGARY



INVOICE

1100 Meridian Road NE, Calgary, Alberta T2A 2N9

PAGE 2

Toll-free 1.888.722.6422 • subaruocalgary.com

T 403.571.3072 • F 403.571.3070

SERVICE ADVISOR: 2877 KEN BAKER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
GREY	15	SUBARU FORESTER	JF2SJAHC4FH454757	[REDACTED]	104316/104316	T563	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN15 IS			16:00 10NOV20			CASH	10NOV20
01JAN15 DD							
R.O. OPENED	READY	OPTIONS: DLR:C.E.M.C. ENG:2.5_Liter					
08:26 10NOV20	15:48 10NOV20						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

FOR OUTSTANDING RECALLS AND CONFIRMATION OF
IN SERVICE DATE AND WARRANTY STATUS

PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE C:	0.00

INFO INFORMATION

PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE D:	0.00

E CONFIRM SHUTTLE

INFO INFORMATION

PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE E:	0.00

EST: 149.95 10NOV20 08:26 SA: 2877

CONTACT:

CREATED 2020-11-02 04:55:00PM
TAKEN BY CHRISTHI AN REYES

DID YOU KNOW WE SERVICE ALL MAKES AND MODELS
BOOK YOUR APPOINTEMENT ONLINE NOW AT
WWW.SUBARUCALGARY.COM

WINTER IS HERE, ASK ABOUT OUR SPECIALS
ARE YOUR TIRES LACKING TRACTION?
ASK ABOUT OUR GREAT DEALS ON TIRES AND WHEELS

GST

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.	TERMS: STRICTLY CASH UNLESS ARRANGEMENT MADE	DESCRIPTION	8.62
	2% PER MONTH (24% PER ANNUM) MAY BE CHARGED ON OVERDUE ACCOUNTS	LABOR AMOUNT	149.95
	I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, or any other cause beyond your control or for any delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledge on above vehicle to secure the amount of repairs thereto.	PARTS AMOUNT	0.00
	I hereby acknowledge my indebtedness in the amount of \$ _____ being the total amount owing, or balance owing for repairs, parts & accessories describe in this work order.	GAS, OIL, LUBE	0.00
		SUBLET AMOUNT	0.00
		MISC. CHARGES	22.49
		TOTAL CHARGES	172.44
		LESS INSURANCE	0.00
		SALES TAX	8.62
		PLEASE PAY THIS AMOUNT	181.06

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

X

GST # R101134690

MULTI-POINT INSPECTION FORM

DATE OF SERVICE Nov. 10, 2020 R.O. NUMBER 160882

563



CUSTOMER NAME [Redacted] PHONE [Redacted]
 YEAR/MODEL 15 Forester KILOMETERS 104316 VIN [Redacted]
 CUSTOMER SIGNATURE _____ DATE _____

SUBARU

- Requires Immediate Attention
- Checked and OK
- Requires Further Attention
- Not Applicable

Drive Components, Suspension & Exterior Inspection

- Shocks/Struts
- Suspension & Chassis Components/Bushings/Ball Joints
- Steering System (rack/tie rods/pump/lines)
- Axles/CV Boots
- Prop Shaft/U-joints
- Exhaust System (damage, loose parts, leaks)
- Transmission (linkages/clutch hydraulics)
- Engine/Transmission (damage, fluid leaks)
- Engine/Transmission Mounts
- Front/Rear Differentials
- Brake Hoses/Lines
- Calipers/Slides (condition, movement)

Maintenance Schedule OK

Check Factory-Scheduled Maintenance Interval

Open Recalls/Campaigns Yes No

Recall #: _____ Recall #: _____
 Recall #: _____ Recall #: _____

Interior Inspection

- Cabin Air Filter
- Door Latches/Power Lock Operation
- Windshield Wiper Condition/Washer Operation
- Parking Brake: Mechanical Electronic
- Brake Pedal & Master Cylinder Operation
- Clutch Pedal & Master Cylinder Operation
- Seat Belt Operation
- Instruments, Gauges, Warning Lights N/A
- SUBARU STARLINK® Connected Services
- Horn Operation
- Exterior Lighting Operation (headlamps, foglamps, signals, tail & brake lights, reverse lamps)
- Heating, Ventilation, AC System Operation (hoses/lines/leaks)
- Glass/Power Window Operation
- Rearview & Side Mirror Operation (auto-dimming)
- 12V Outlet(s) Operation

Driver Side Rear **Driver Side Front**


- | | |
|------------------------------------------------------------------|------------------------------------------------------------------|
| <input checked="" type="checkbox"/> Brake Pads <u>5</u> mm | <input checked="" type="checkbox"/> Brake Pads <u>6</u> mm |
| <input checked="" type="checkbox"/> Pad/Caliper Movement | <input checked="" type="checkbox"/> Pad/Caliper Movement |
| <input checked="" type="checkbox"/> Rotor Condition | <input checked="" type="checkbox"/> Rotor Condition |
| <input checked="" type="checkbox"/> Tire Tread <u>5</u> /32" | <input checked="" type="checkbox"/> Tire Tread <u>5</u> /32" |
| <input checked="" type="checkbox"/> Wear Pattern | <input checked="" type="checkbox"/> Wear Pattern |
| <input checked="" type="checkbox"/> Tire Pressure* <u>32</u> PSI | <input checked="" type="checkbox"/> Tire Pressure* <u>37</u> PSI |

Brake Pad Thickness

- Less than 3mm
- 3mm-6mm
- Over 6mm

Visual Brake Inspection Performed | Wheels: On Off

Exterior Body Damage

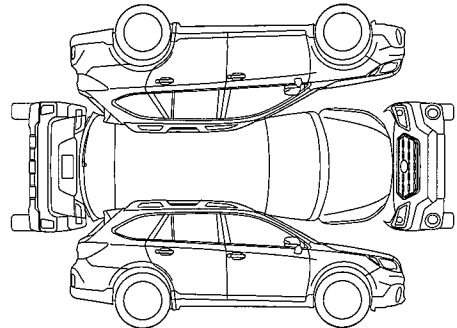

Underhood Inspection

- Accessory Drive Belt(s)
- Radiator/Coolant System/Hoses (condition/leaks)
- Engine Air Filter
- Hood Latch

Fluid Level Inspection

OK	Filled		Attention Required
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	Engine Oil	<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	Coolant	<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	Power Steering Fluid (Non-EPS only)	<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	Transmission Fluid	<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	Front Differential Oil	<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	Rear Differential Oil	<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	Brake/Clutch Fluid	<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	Washer Fluid	<input checked="" type="checkbox"/>

Passenger Side Rear **Passenger Side Front**

- | | |
|------------------------------------------------------------------|------------------------------------------------------------------|
| <input checked="" type="checkbox"/> Brake Pads <u>5</u> mm | <input checked="" type="checkbox"/> Brake Pads <u>6</u> mm |
| <input checked="" type="checkbox"/> Pad/Caliper Movement | <input checked="" type="checkbox"/> Pad/Caliper Movement |
| <input checked="" type="checkbox"/> Rotor Condition | <input checked="" type="checkbox"/> Rotor Condition |
| <input checked="" type="checkbox"/> Tire Tread <u>5</u> /32" | <input checked="" type="checkbox"/> Tire Tread <u>5</u> /32" |
| <input checked="" type="checkbox"/> Wear Pattern | <input checked="" type="checkbox"/> Wear Pattern |
| <input checked="" type="checkbox"/> Tire Pressure* <u>32</u> PSI | <input checked="" type="checkbox"/> Tire Pressure* <u>37</u> PSI |
- Spare Tire/Repair Kit _____ PSI Lug Nut Torque _____ ft-lb

Tire Set Matches
 Under 3/32" remaining 3/32" - 5/32" remaining 6/32" remaining
 *Tire pressure is set to factory-recommended specifications

Alignment Recommended
 Wheel Balance Recommended

Battery Inspection

- Terminals/Cables
- Battery(ies) Test/Condition Test Code: _____

Technician's Comments/Additional Recommendations:



Canadian Tire Associate Store 0642
100 - 201 Southridge Drive

Okotoks AB T1S 2C9
Phone: 403-938-5719 Fax: 403-938-5899
e-mail: canadiantireshop@gmail.com

PAGE: 1
DATE: Nov 23 20



INVOICE
20064200066006
(Copy)

GST REG#: 8777141162
PST REG#:



MOBILE : HOME: [REDACTED]
BUSINESS: FAX : [REDACTED]
EMAIL :

COLOUR	VEHICLE DESCRIPTION	PLATE	UNIT#	TAG	ODO IN
GREY	2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC	[REDACTED]			104958
VIN	VEHICLE OPTIONS			ADV	ODO AUTH
JF2SJAHC4FH454757				JC01	104958
TIME IN	PROMISED	TERMS	GST EXEMPT#	P.O.	ODO OUT
8:00 AM		Cash			104958

QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE
4	0072017	ONLINE ORDER #: 7851354147150 PICKUP CODE: 5529 MOTOMASTER 225/60R17 99H HY ED 225/60R17 99H MotoMaster Hydra Edge Tour P225/60R17 DOT Number: 153-FXRNCT-2620 DOT Number: 2620 DOT Number: 2620 DOT Number: 2620 Effective until Nov 19 2020	T1	122.24	488.96
4	NTINST	NEW TIRE INSTALLATION RB02 Nov 16 20		N/C	N/C
4	NTMBA	New Tire Balancing RB02 Nov 16 20 DISPOSE OF CUSTOMERS ORIGINAL TIRE(S) ? YES / NO RECOMMEND ALIGNMENT WHEN PURCHASING NEW TIRES. TIRES SHOULD BE ROTATED EVERY 10,000 - 20,000 KM.		20.00	80.00
1	ALI05	Free Alignment Check RB02 Nov 16 20 English: Visit canadiantire.ca/tireregistration to register your new tire's DOT codes French: Enregistrez les codes DOT sur canadiantire.ca/enregistrementdepneus *TIRE REPLACEMENT ADVANTAGE* *PNEUS DE REMPLACEMENT AVANTAGE* Free spare tire change service for the first year after purchase when Tire Replacement Advantage purchased. (Service gratuit de emplacement d'un pneu de secours pour la première année après l'achat lors d'une inscription au programme Valeur à neuf.) Call Roadside Assistance if you require assistance: (Appelez l'Assistance routière pour obtenir de l'aide): 1-800-444-4597		N/C	N/C
4	2987292	ENVIRONMENTAL FEE		4.00	16.00
4	2990101	REPLACEMENT AD Vehicle Inspection Report Suggested Preventive -- **LIGHTS/ACCESSORIES** : Wiper Blades		12.99	51.96

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.

Customer Signature: _____

PARTS:	
LABOUR:	
OTHER:	
SUB-TOTAL:	
GST/HST:	
PST:	
TOTAL:	Cont'd



Canadian Tire Associate Store 0642
100 - 201 Southridge Drive

Okotoks AB T1S 2C9
Phone: 403-938-5719 Fax: 403-938-5899
e-mail: canadiantireshop@gmail.com

PAGE: 2

DATE: Nov 23 20




INVOICE

20064200066006
(Copy)

GST REG#: 8777141162

PST REG#:



MOBILE :
BUSINESS:
EMAIL :



COLOUR	VEHICLE DESCRIPTION	PLATE	UNIT#	TAG	ODO IN
GREY	2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC				104958
VIN	VEHICLE OPTIONS			ADV	ODO AUTH
JF2SJAHC4FH454757				JC01	104958
TIME IN	PROMISED	TERMS	GST EXEMPT#	P.O.	ODO OUT
8:00 AM		Cash			104958

QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE
		-- **LIGHTS/ACCESSORIES**: Fog Lights Subtotals Tax out 0.00 Tax in 0.00			
1	SS	Shop Supplies Authorized on: Nov 23 2020 PLEASE HAVE YOUR LUG NUTS RETORQUED AFTER 100 KM. PLEASE VISIT US AT WWW.TELLCDNTIRE.COM AND FILL OUT A QUICK SURVEY. YOUR FEEDBACK IS IMPORTANT TO US *** Warranty Code Legend *** T1: See Service Manager for details *** Global Warranty Message *** Installed parts warranties applicable only when product is installed at a Canadian Tire Automotive Service Centre, otherwise warranties may vary. Warranty not available for commercial use. A minimum labour warranty of 100 days / 5500 km applies to installed parts unless otherwise stated above. Installed parts warranty starts on the completion date shown on the customer invoice. Please see auto parts staff for cash & carry parts warranties. ***PRIVACY TERMS*** Canadian Tire Corporation, Limited, its affiliates, Associate Dealers, and service providers ("CTC" or "our") collect and use the personal information provided by you to fulfill this contract. CTC may also collect and use your information to administer the delivery of and market warranties, products, services, and loyalty programs to you, and to analyze your relationship with us. Please visit www.canadiantire.ca for details on CTC's privacy policy. If you do not wish for your information to be kept in our database, please contact CTC's Corporate Customer Relations at 1-866-846-5841 or via email at https://www.ctfs.com/ContactUs/. ***Tire Storage Terms*** Storage term: (applicable only to customers who have purchased tire storage) Tires will be stored up to a maximum of 8 months from Invoice date OR until customer requests to have Tires removed from the storage location for any reason, at which point the storage term will end. Canadian Tire is not responsible for unclaimed tires at expiration of storage term. Tires left beyond		5.60	5.60

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.

Customer Signature: _____

PARTS:	
LABOUR:	
OTHER:	
SUB-TOTAL:	
GST/HST:	
PST:	
TOTAL:	Cont'd



Canadian Tire Associate Store 0642
100 - 201 Southridge Drive

Okotoks AB T1S 2C9
Phone: 403-938-5719 Fax: 403-938-5899
e-mail: canadiantireshop@gmail.com


PAGE: 3
DATE: Nov 23 20



INVOICE
20064200066006
(Copy)

GST REG#: 8777141162

PST REG#:



MOBILE :
BUSINESS:
EMAIL :

HOME: [Redacted]
FAX : [Redacted]

COLOUR	VEHICLE DESCRIPTION	PLATE	UNIT#	TAG	ODO IN
GREY	2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC	[Redacted]			104958
VIN	VEHICLE OPTIONS	ADV	ODO AUTH		
JF2SJAHC4FH454757		JC01	104958		
TIME IN	PROMISED	TERMS	GST EXEMPT#	P.O.	ODO OUT
8:00 AM		Cash			104958

QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE
		30 days of term expiration date will be disposed of without any liability or obligation to customer. Payment for Tire Storage is deemed to be acceptance of these terms by customer.			

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.

Customer Signature: _____

PARTS:	488.96
LABOUR:	80.00
OTHER:	73.56
SUB-TOTAL:	642.52
GST/HST:	32.13
PST:	N/C
TOTAL:	674.65



RepairOrder 20064200066006

Date: Nov 23 2020

Page: 1/3

2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC

Odometer In: 104958

VIN: JF2SJAHC4FH454757

Odometer Out: 104958



****DASH LIGHTS****

Comments

- Check Engine Light On
- ABS Light N/A On
- TPMS Light N/A On
- Oil Light Reset N/A Reset
- Other Lights On

****LIGHTS/ACCESSORIES****

Comments

- Wiper Blades N/A On
Suggest: Technician's recommendation based on substantial and informed experience
rear wiper not working
- Washer Pump
- Horn
- Headlights
- Fog Lights N/A On
Suggest: Technician's recommendation based on substantial and informed experience
drivers fog light out
- Turn Signal Lights
- Parking Lights
- Brake Lights
- Reverse Lights
- Plate Light

****UNDER HOOD****

Comments

- Battery Test 1. Rated CCA 2. Actual CCA 3. N/A
600 620
- Battery Terminals Not Accessible
- Belt(s)
- Tensioner(s) N/A
- Coolant Hoses
- Air Filter

Reason Codes

Required:

- A - Part no longer performs intended function
- B - Part does not meet a design specification (regardless of performance)
- C - Part is missing

Suggested:

- 1 - Part is close to end of useful life (just above discard specifications, or weak, failure likely to occur soon, etc.)
- 2 - Address a customer need, convenience, or request (to stiffen ride, enhance performance, eliminate noise, etc.)
- 3 - To comply with maintenance recommended by the vehicle Original Equipment Manufacturer
- 4 - Technician's recommendation based on substantial and informed experience

2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC

Odometer In: 104958

VIN: JF2SJAHC4FH454757

Odometer Out: 104958

Plate:


 Cabin Air Filter N/A

****UNDER HOOD FLUIDS****
Comments

 Coolant 1. pH | 6 2. Freeze Point | 35

 Oil Level on Arrival Low

 Windshield Washer

 Power Steering N/A

 Transmission N/A

 Brake(visual)

 Clutch(visual) N/A

****UNDER VEHICLE****
Comments

 Fluid Leaks

 Fuel Filter N/A

 CV Boots N/A

 Brake/Fuel Lines

 Chassis Lube N/A

 Seasonal Changeover

 Alignment Check

 Rust Protection N/A

****TIRES****
Comments

 Front Driver /32nds | PSI/Arrival | PSI/OEM Specs
 2 | 32 | 30

 Front Passenger /32nds | PSI/Arrival | PSI/OEM Specs
 2 | 32 | 30

 Rear Driver /32nds | PSI/Arrival | PSI/OEM Specs
 2 | 32 | 30

 Rear Passenger /32nds | PSI/Arrival | PSI/OEM Specs
 2 | 32 | 30

****BRAKE INSPECTION****
Comments

 NOTE: Brake inspection will only be completed when the tires are removed. N/A

Reason Codes

Required:

- A - Part no longer performs intended function
- B - Part does not meet a design specification (regardless of performance)
- C - Part is missing

Suggested:

- 1 - Part is close to end of useful life (just above discard specifications, or weak, failure likely to occur soon, etc.)
- 2 - Address a customer need, convenience, or request (to stiffen ride, enhance performance, eliminate noise, etc.)
- 3 - To comply with maintenance recommended by the vehicle Original Equipment Manufacturer
- 4 - Technician's recommendation based on substantial and informed experience

RepairOrder 20064200066006

2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC



Odometer In: 104958

VIN: JF2SJAHC4FH454757

Odometer Out: 104958

Plate:

Left Front Brake Pads

1.OK(+6 mm) 2.Suggested(4-5 mm) 3.Required(-3 mm)

Right Front Brake Pads

1.OK(+6 mm) 2.Suggested(4-5 mm) 3.Required(-3 mm)

Left Rear Brake Pads

1.OK(+6 mm) 2.Suggested(4-5 mm) 3.Required(-3 mm)

Right Rear Brake Pads

1.OK(+6 mm) 2.Suggested(4-5 mm) 3.Required(-3 mm)

Reason Codes

Required:

- A - Part no longer performs intended function
- B - Part does not meet a design specification (regardless of performance)
- C - Part is missing

Suggested:

- 1 - Part is close to end of useful life (just above discard specifications, or weak, failure likely to occur soon, etc.)
- 2 - Address a customer need, convenience, or request (to stiffen ride, enhance performance, eliminate noise, etc.)
- 3 - To comply with maintenance recommended by the vehicle Original Equipment Manufacturer
- 4 - Technician's recommendation based on substantial and informed experience

Canadian Tire #642
100 -201 Southridge Drive
Okotoks Alberta
T1S 2C9
Phone # 403-938-5719


66006

VIN: JF2SJAHC4FH454757
Year: 15
Date: 11/23/20 9:17 AM





Subaru 2015 Forester
Self-Directed 4-Wheel Alignment
Before Measurements

Left Front

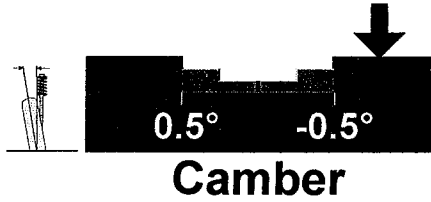


Right Front

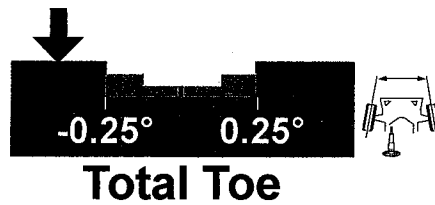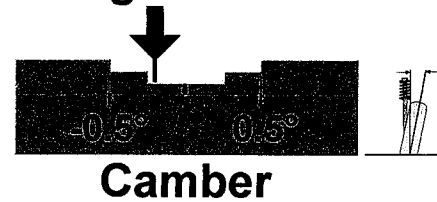


- Excessive Camber causes shoulder wear and poor handling.
- Negative Camber could cause road shock or poor ride quality.
- Excessive Toe causes scuffing, shoulder wear and poor fuel economy.
- Excessive cross Camber could cause a pull to the right.

Left Rear

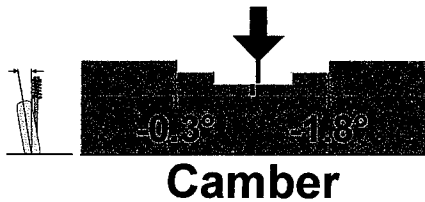

Right Rear

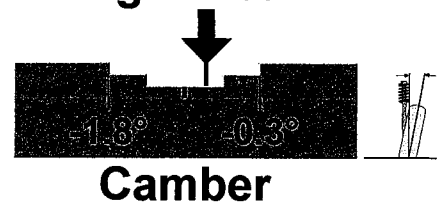

- All angles on the rear axle are within manufacturer's specifications.



Canadian Tire Associate Store 0642
 100 - 201 Southridge Drive
 Okotoks AB T1S 2C9
 Phone: 403-938-5719 Fax: 403-938-5899
 e-mail: canadiantireshop@gmail.com

PAGE: 1
 DATE: Apr 14 20




INVOICE
20064200061550
 (Copy)

GST REG#: 8777141162
 PST REG#:



MOBILE :
 BUSINESS :
 EMAIL :

HOME :
 FAX :



COLOUR	VEHICLE DESCRIPTION		PLATE	UNIT#	TAG	ODO IN
GREY	2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC					93761
VIN	VEHICLE OPTIONS				ADV	ODO AUTH
JF2SJAHC4FH454757					RAB01	93761
TIME IN	PROMISED	TERMS	GST EXEMPT#		P.O.	ODO OUT
1:00 PM		Cash				93761
QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE	
1	FPOPR	OUT OF PROVINCE INSPECTION 014 Apr 14 20		159.99	159.99	
1	SS	Shop Supplies Authorized on: Apr 14 2020 PLEASE HAVE YOUR LUG NUTS RETORQUED AFTER 100 KM. PLEASE VISIT US AT WWW.TELLCDNTIRE.COM AND FILL OUT A QUICK SURVEY. YOUR FEEDBACK IS IMPORTANT TO US *** Global Warranty Message *** Installed parts warranties applicable only when product is installed at a Canadian Tire Automotive Service Centre, otherwise warranties may vary. Warranty not available for commercial use. A minimum labour warranty of 100 days / 5500 km applies to installed parts unless otherwise stated above. Installed parts warranty starts on the completion date shown on the customer invoice. Please see auto parts staff for cash & carry parts warranties. ***PRIVACY TERMS*** Canadian Tire Corporation, Limited, its affiliates, Associate Dealers, and service providers ("CTC" or "our") collect and use the personal information provided by you to fulfill this contract. CTC may also collect and use your information to administer the delivery of and market warranties, products, services, and loyalty programs to you, and to analyze your relationship with us. Please visit www.canadiantire.ca for details on CTC's privacy policy. If you do not wish for your information to be kept in our database, please contact CTC's Corporate Customer Relations at 1-866-846-5841 or via email at https://www.ctfs.com/ContactUs/. ***Tire Storage Terms*** Storage term: (applicable only to customers who have purchased tire storage) Tires will be stored up to a maximum of 8 months from Invoice date OR until customer requests to have Tires removed from the storage location for any reason, at which point the storage term will end. Canadian Tire is not		11.20	11.20	

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.

Customer Signature: _____

PARTS:	
LABOUR:	
OTHER:	
SUB-TOTAL:	
GST/HST:	
PST:	
TOTAL:	Cont'd



Canadian Tire Associate Store 0642
 100 - 201 Southridge Drive
 Okotoks AB T1S 2C9
 Phone: 403-938-5719 Fax: 403-938-5899
 e-mail: canadiantireshop@gmail.com


PAGE: 2
 DATE: Apr 14 20



INVOICE
20064200061550
 (Copy)

GST REG#: 8777141162
 PST REG#:

SOLD TO:



MOBILE :
 BUSINESS:
 EMAIL :

HOME: [REDACTED]
 FAX :


COLOUR	VEHICLE DESCRIPTION	PLATE	UNIT#	TAG	ODO IN	
GREY	2015 SUBARU TRUCK FORESTER 4-2498 2.5L DOHC	[REDACTED]			93761	
VIN	VEHICLE OPTIONS				ADV	ODO AUTH
JF2SJAHC4FH454757					RAB01	93761
TIME IN	PROMISED	TERMS	GST EXEMPT#	P.O.	ODO OUT	
1:00 PM		Cash			93761	
QTY	ITEM	DESCRIPTION	WARR	NET	EXT.PRICE	
		responsible for unclaimed tires at expiration of storage term. Tires left beyond 30 days of term expiration date will be disposed of without any liability or obligation to customer. Payment for Tire Storage is deemed to be acceptance of these terms by customer.				

INVOICE TO:

I hereby authorize you and your employees to carry out the repairwork described above and to purchase on my account any parts and materials necessary to carry out the repairwork subject to the estimate described above. I hereby authorize you and your employees to operate the vehicle listed above in connection with the repairwork, including operation for the purposes of testing, inspection or delivery. I HEREBY RELEASE AND FOREVER DISCHARGE YOU AND EACH OF YOUR EMPLOYEES FROM ANY LOSSES I MAY SUFFER RELATING TO DAMAGE TO OR LOSS OF MY VEHICLE AND/OR ANY ITEMS CONTAINED THEREIN THAT ARE CAUSED BY CIRCUMSTANCES BEYOND YOUR CONTROL. I acknowledge that, upon the completion of the repairwork authorized hereby, you will have a lien pursuant to applicable repair and storage lien legislation and that you may register that lien and seize, at your discretion and at my sole cost and expense, the vehicle for non-payment of any invoice issued for such repairwork. By signing below I acknowledge and agree to the terms and conditions above and to those printed on the reverse side of this form.

Customer Signature: _____

PARTS:	N/C
LABOUR:	159.99
OTHER:	11.20
SUB-TOTAL:	171.19
GST/HST:	8.56
PST:	N/C
TOTAL:	179.75



3819 MACLEOD TRAIL SOUTH
CALGARY, ALBERTA T2G 2R3

PHONE: (403) 287-2544
FAX: (403) 243-1277
TOLL FREE 1-800-668-3128
www centaursubaru.ca

CENTAUR | SUBARU

SO # 417616

**SERVICE ORDER
CUSTOMER COPY**



Printed 12/21/2020 4:12:29 PM

User LMY Page 1

Customer No [REDACTED]
[REDACTED]
Home [REDACTED]
Cell [REDACTED]
Email [REDACTED]
Term CASH

Advisor	Todd Philips	Promised	12/21/2020 1:00 PM	Tag
Shop	S1	Opened	12/21/2020 7:12 AM	Location
Priority		Cashiered	12/21/2020 4:12 PM	PO #

License No	Odometer In	Odometer Out	InServ Date	Stock No
[REDACTED]	106260	106262		
Year	Make	Model	Model No	Colour
2015	SUBARU	FORESTER	FFI	1K DARK GREY
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
JF2SJAHC4FH454757				
Engine Size	2.5L 4 Cyl DOHC 16V w/VVT -inc:		Fleet #	

Request	Description	Job	CSR	Status
300	REPORTS BRAKE LIGHTS RANDOMLY COME ON AFTER VEHICLE IS PARKED/TURNED OFF. BRAKE LIGHT SWITCH ON HOLD (IF REQUIRED). DIAGNOSE AND ADVISE.	1	71	Original

Labour	Description	Type	Hours	Amount
100	TECH CONFIRMED CONCERN - FOUND BRAKE LIGHT SWITCH OUT OF ADJUSTMENT - READJUSTED BRAKE LIGHT SWITCH - NO FURTHER CONCERNS	CP	0.50	0.00

Technician	122 - LUCAS	Parts Total	0.00
		Labour Total	0.00
		Request Total	0.00


YOU CAN NOW BOOK YOUR NEXT SERVICE ON LINE AT
WWW.CENTAURSUBARU.CA AND IF YOU HAVE ANY COMMENTS
OR CONCERNS, PLEASE CONTACT TODD PHILIPS AT 287-2544

Labour	0.00
Parts	0.00
Supplies	0.00
SUB-TOTAL	0.00
GST	0.00
TOTAL INVOICE	0.00

PRIVACY NOTICE

I have read the Privacy Notice on the back of this document.
 By checking this box, I consent to receiving marketing updates and information regarding products and services from Dealer and/or Dealer's Parent Organization.
Customer Signature: _____ Date: _____

INDEBTEDNESS IS HEREBY ACKNOWLEDGED FOR THE AMOUNT INDICATED ON THIS INVOICE FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE. 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.
GST # R100867001
*Thank You
for your
business*



3819 MACLEOD TRAIL SOUTH
CALGARY, ALBERTA T2G 2R3

PHONE: (403) 287-2544
FAX: (403) 243-1277
TOLL FREE 1-800-668-3128
www centaursubaru.ca

CENTAUR | SUBARU
SO # 413591

**SERVICE ORDER
CUSTOMER COPY**



Printed 08/12/2020 3:38:52 PM

User LMY Page 1

Customer No [REDACTED]

[REDACTED]

Term CASH

Advisor	STEFFAN	Promised	08/12/2020 5:30 PM	Tag
Shop	S1	Opened	08/12/2020 7:36 AM	Location
Priority		Cashiered	08/12/2020 3:38 PM	PO #

License No	[REDACTED]	Odometer In	100236	Odometer Out	100238	InServ Date		Stock No	
Year	2015	Make	SUBARU	Model	FORESTER	Model No	FFI	Colour	1K DARK GREY
Vehicle ID No	JF2SJAHC4FH454757	Selling Dealer		Extended Warranty		Delivery Date			
Engine Size	2.5L 4 Cyl DOHC 16V w/VVT -inc:	Fleet #							

Request	Description	Job	CSR	Status
150000	150000 KLM INSPECTION	1	50	Original

Labour	Description	Type	Hours	Amount
150000	150000 KLM INSPECTION COMPLETED - OIL CHANGED - CHECKED/TOPPED UP ALL FLUIDS - SET ALL TIRE PRESSURES - LUBRICATED ALL LOCKS AND HINGES - SEE ATTACHED REPORT FOR DETAILS	CPM	0.50	39.99
100	TECH NOTES LEFT FOGLAMP BULB BURNT OUT - NO STOCK - REAR WIPER INOP	CP	0.00	0.00

Part	Description	Req	Bin	Type	Price	Amount
EHC123	ENVIRONMENTAL CHARGE	1	SHOP	CRO	0.50	0.50
EHC0456	ENVIRONMENTAL CHARGE	6	SHOP	CRO	0.05	0.30
SCI800168	BULK 0W20 SUPER 3000 MOBIL, 1 L	6	SHOP	CRO	8.02	48.12
15208AA15A	OIL FILTER 2013 2.5 LEG/OBK	1	M8	CRO	10.95	10.95
803916010	GASKET OIL PAN	1	DR1	CRO	2.33	2.33

Parts Total	62.20
Labour Total	39.99
Request Total	102.19

Request	Description	Job	CSR	Status
100	ABS, HILL LIGHT ON	2	50	Original

Labour	Description	Type	Hours	Amount
100	TECH CONFIRMED CONCERN - RELATED TO BRAKE LIGHT SWITCH - FIXED AS PART OF RECALL	CP	0.00	0.00

Parts Total	0.00
Labour Total	0.00
Request Total	0.00

Request	Description	Job	CSR	Status
WUE-90	BRAKE LIGHT SWITCH REPLACEMENT	3	50	Original


Labour	Description	Type	Hours	Amount
WUE-90	BRAKE LIGHT SWITCH REPLACEMENT COMPLETED	WL		

Part	Description	Req	Bin	Type	Price	Amount
------	-------------	-----	-----	------	-------	--------

PRIVACY NOTICE

I have read the Privacy Notice on the back of this document.
 By checking this box, I consent to receiving marketing updates and information regarding products and services from Dealer and/or Dealer's Parent Organization.
 Customer Signature: _____ Date: _____

INDEBTEDNESS IS HEREBY ACKNOWLEDGED FOR THE AMOUNT INDICATED ON THIS INVOICE FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE. 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.
 GST # R100867001
Thank You for your business



3819 MACLEOD TRAIL SOUTH
CALGARY, ALBERTA T2G 2R3

PHONE: (403) 287-2544
FAX: (403) 243-1277
TOLL FREE 1-800-668-3128
www centaursubaru.ca

CENTAUR | SUBARU
SO # 413591

**SERVICE ORDER
CUSTOMER COPY**



Printed 08/12/2020 3:38:53 PM

User LMY Page 2

Customer No		Advisor STEFFAN	Promised 08/12/2020 5:30 PM	Tag
		Shop S1	Opened 08/12/2020 7:36 AM	Location
		Priority	Cashiered 08/12/2020 3:38 PM	PO #

License No	Odometer In	Odometer Out	InServ Date	Stock No
	100236	100238		
Year 2015	Make SUBARU	Model FORESTER	Model No FFI	Colour 1K DARK GREY
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
JF2SJAHC4FH454757				
Engine Size 2.5L 4 Cyl DOHC 16V w/VVT-inc:	Fleet #			

83319FJ000 SW STOP LP REPAIR

1 M2 W

Parts Total 0.00
Labour Total 0.00
Request Total 0.00

Request	Description	Job	CSR	Status
WUT-05	REAR COIL SPRING RECALL - Please ensure belongings are removed from rear storage area of the vehicle.	4	50	Original

Labour	Description	Type	Hours	Amount
WUT-05	REAR COIL SPRING RECALL - COMPLETED	WL		

Part	Description	Req	Bin	Type	Price	Amount
X2038SG010	COIL SPRING R KIT	1	RRFLOOR	W		

Parts Total 0.00
Labour Total 0.00
Request Total 0.00

YOU CAN NOW BOOK YOUR NEXT SERVICE ON LINE AT
WWW.CENTAURSUBARU.CA AND IF YOU HAVE ANY COMMENTS
OR CONCERNS, PLEASE CONTACT TODD PHILIPS AT 287-2544

Labour 39.99
Parts 62.20
Supplies 0.00
SUB-TOTAL 102.19
GST 5.11

TOTAL INVOICE 107.30

PRIVACY NOTICE

I have read the Privacy Notice on the back of this document.
 By checking this box, I consent to receiving marketing updates and information regarding products and services from Dealer and/or Dealer's Parent Organization.
Customer Signature: _____ Date: _____

INDEBTEDNESS IS HEREBY ACKNOWLEDGED FOR THE AMOUNT INDICATED ON THIS INVOICE FOR REPAIRS, PARTS AND ACCESSORIES DESCRIBED IN THIS INVOICE. TERMS: STRICTLY CASH UNLESS ARRANGEMENTS MADE. 2% PER MONTH MAY BE CHARGED ON OVERDUE ACCOUNTS.

GST # R100867001

*Thank You
for your
business*



CAR-X TIRE & AUTO - AM

429 S. DUFF AVE.
 AMES, IA 50010
 515-232-5666

INVOICE #: 0070845

Date: 4/29/19

Page: 1

WWW.CARXAMES.COM

Customer : [Redacted]
 Address : [Redacted]
 City : [Redacted]
 Phone 1 : [Redacted]
 Phone 2 : [Redacted]

Vehicle : 2015 SUBT FORESTER
 License : [Redacted]
 VIN : JF2SJAH4C4FH454757
 Engine : 4-2498 2.5L DOHC
 Mileage : 77768

Othe :
 Trans:
 Othe :

Tech#	Labor Description		Part Description	Reason for Replacement	PARTS	LABOR	SUBTOTAL
	Qty	Part Number					
818	0W20 Synthetic Oil Change - Up to 5 quarts				65.01	0.00	65.01
	Engine Oil Capacity Quarts		5.1 INCLUDES FILTER CAPACITY				0.00
	1.00	7055	GOLD OIL FILTER - SPEC1		9.99		
	1.00		RECYCLING FEE		3.00		
	5.10	VLVSR020B	0W20 API-SN DA FULL SYN		52.02		
		Visc Class:	SAE 0W20 API-SN				
		Brand Name:	DA				
		Eng Srv Cat:	GF-5 Dexos 1				
		Inact Svc Cat:					
Payments:							0.00
MSTR CHARG VISA, \$69.56, on 04/29/19							
CardNo: [*****8787], AuthorizationNo: []							

Your Car-X Warranty:

All services are warranted under the Car-X Quality Assurance Guarantee, please refer to warranty pamphlet for specific coverage of parts and services. In the event of failure, simply present your original paid invoice to any participating Car-X Auto Center for replacement. Installation charges on warranted replacement parts may apply. This warranty does not cover the cost of any additional repairs that may be required at the time of warranty replacement. Not all Car-X Service Centers perform all services. Warranty replacement is valid only to the original purchaser of the parts/services and does not extend to subsequent vehicle owner(s). This warranty does not cover damage by collision, abuse, self-repair, or by failure of other parts or components. Commercial vehicle warranties may differ, please see manager for details. For any questions regarding warranties or service-related problems, please call the Des Moines area regional supervisor at (515) 223-7178. This warranty is made by Car-X, Inc., and gives you specific legal rights. Seller is a franchisee of Car-X, Inc. An express mechanics lien is acknowledged on this vehicle to secure amount of repairs.

Labor:	\$0.00
Parts:	\$65.01
Sublet:	\$0.00
Other Fees:	\$0.00
Shop Supply:	\$65.01
Subtotal:	\$4.55
Sales Tax:	
Total:	\$69.56
Paid:	\$69.56
Due:	\$0.00

INVOICE

Control No. 475642 INV.

Customer Signature