

5100 Shaganappi Trail N.W

Calgary, AB T3A 2L7

Phone: (403) 247-2411 • Fax: (403) 202-3410

90143

Toll Free: 1-866-459-6712

User

SO # 524484

Printed

SERVICE ORDER **CUSTOMER COPY - REPRINT**

Type

W

Amount

0.00

159.95

14.13

188.00

202.13

Page

Customer No Term CASH, DEBIT

11/29/2021 12:57:26 PM

| Advisor Shop | DAIN VVEDER- | Promised | 09/16/2021 4:00 PM 06/08/2021 12:13 PM | Tag | 9253 | |
|-----------------|--------------|---------------------|---|-----|--------|--|
| Priority | S1 280 | Opened Cashiered | 06/23/2021 3:45 PM | | 524484 | |

| Priority | 200 | | sniered 00/2 | 23/2021 3.45 PIVI PU # | |
|----------|--------|--------------|--------------|------------------------|----------------------|
| License | No | Odometer In | Odometer O | ut InServ Date | Stock No |
| | | 124667 | 124854 | 02/29/2016 | K56229 |
| Year | Make | Model | | Model No | Colour |
| 2016 | KIA | SOREN | ITO | | RED |
| Vehicle | ID No | Selling | Dealer | Extended Warranty | Delivery Date |
| 5XYPKE | A17GG1 | 57133 | | XT | 02/29/2016 |
| | | OL 14 DIR DO | | Fleet # | |
| | | | | | |

| Request | Description | Job | CSR | Status |
|---------|--|-----|-----|----------|
| CELO | MIL BEGAN FLASHING AND WENT INTO LIMP MODE. CAR TOWED IN. Diagnose and report on | 1 | DAN | Original |
| | cause(s) of "Check Engine" light On. Diagnosis includes visual inspection of affected components, | | | |
| | adjustment of necessary fluid levels, scanning of the relevant system(s) for fault codes, checking for | | | |
| | manufacturer updates per fault code instructions and submission of an estimate for further diagnosis | | | |
| | or repair. \$159.95 | | | |

Labour Description **CELO** Diagnose and report on cause(s) of "Check Engine" light On. Diagnosis includes visual inspection of affected components, adjustment of necessary fluid levels, scanning of the relevant system(s) for fault codes, checking

for manufacturer updates per fault code instructions and submission of an estimate for further diagnosis or repair. \$159.95

DIAGNOSIS DIAGNOSIS 188.00 Shp Description Bin Type Price Part Amount **ENGINE ASSY-SUB** W 211012GK32QQK **TORONTO** 211112GK52QQK SERVICE KIT VAN **DR45** 211112GK72QQK SERVICE KIT 1 W VAN **BOLT-DRIVE PLATE** 7 **DR45** W 2331125050QQK **TUBE ASSY-OIL COOLER** 254702G650QQK 17A04 VAN **BKCTR CMSRP** 11.00 2630035505 FILTER ASSY-ENGINE OIL 11.00 **ENVIRO CMSRP** 0.50 0.50 **FILT ENV FEE** 1 EHC CRO 2.63 **GASKET-OIL PLUG** DR29 2.63 1 2151323001 15B04 219169 QRTZ9000 5W30 5L W

Est Parts MI90245 - MICHAEL BANDELOW Technician CORRECTION IS RECOMMENDED TO: FOLOWING TSB 1202002 Est Labour SCANNED VEHICLE, CHECKED OIL LEVEL, DID BCT TEST, TEST NO PASS Parts Total LONG BLOCK REQUIRED. DID UP A KTAC TECH CASE AS WELL 91466 Labour Total Check oil level **Request Total**

and record on RO. 1.Full system DTC scan & generate VDN 2. Save Freeze Frame Data.

Peformed a BCT. Result is No pass. ktac 91466.

Product Improvement: Engine Replacement Procedures for DTC P1326

SIGNATURE_

(SC026)(SC027)(SC029)

Replace engine.

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$_____BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER. SERVICE CHARGE OF 2% PER MONTH (24% PER ANNUM) CHARGED ON PAST DUE ACCOUNTS.

OH

Cause



5100 Shaganappi Trail N.W

Calgary, AB T3A 2L7

Phone: (403) 247-2411 • Fax: (403) 202-3410

Toll Free: 1-866-459-6712

SO # 524484

SERVICE ORDER



Printed


11/29/2021 12:57:26 PM

CUSTOMER COPY - REPRINT

User

90143

Page

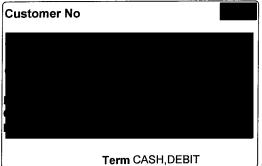

DAIN WEDER-Advisor 09/16/2021 4:00 PM Tag 9253 **Promised an143** 06/08/2021 12:13 PM Location Shop **S**1 Opened 280 Cashiered 06/23/2021 3:45 PM PO # 524484 Priority

License No Year Make **Odometer In Odometer Out** 124667 124854 Model

InServ Date 02/29/2016 **Model No**

Stock No K56229 Colour

2016 ΚIΑ Vehicle ID No

SORENTO Selling Dealer

Extended Warranty

RED **Delivery Date**

5XYPKDA17GG157133 **Engine Size** 2.0L |4 DIR DO

Fleet #

02/29/2016

Correction

Removed engine from car removed all part being swapped over to new Engine block . Replaced all gaskets . torqued all bolts to spec. replaced fuel injector seals and hish pressure line, reassmbled, engine put back in car, reset all adaptations test dorve scanned for codes before and after no codes at this time. Retrun to customer .Fill crankcase with 5W-30 Full Synthetic Oil (~5.8 quarts/5.49 Litres) (For first time fills of all new engines) Confirm that the Rom ID is up-to-date. If not, re-flash the ECU to the latest ROM

Refer to appropriate Knock Sensor Detection System ECU Logic Improvement

(SC026, SC027 or SC029). 7. Verify proper operation of the vehicle with road test, and with the engine ON (running), erase any stored DTCs

(e.g., EPS, ESC, and TPMS) that may have been set by this procedure. Verify no leaks exist and ensure engine oil

and coolant are at their proper level.

If any DTCs are still active, follow any related diagnosis and repair as

needed.Bearing Clearance Test PWA - Engine Replaced

+S/W Inspection and Update

180A32BF 91 . found turbo internals worn and scored due to engine failure . consequential damage due to engine internal failure needs new turbo

| Request | Description | | | Job | CSR | Status |
|------------------------------|--|--------------|----------|------|-------|----------|
| 210A02 | Perform a Service Campaign (SC039) Sorento (UMA) 2.0L T-GDI Auxiliary Canister Kit Installation | | allation | 2 | DAN | Original |
| Labour | Description | | | | Type | Amount |
| 210A02 | Perform a Service Campaign (SC039) Sorento (UMA) 2.0L T-GDI Auxiliary Canist | er Kit Insta | allation | | W | |
| Part | Description | Shp | Bin | Type | Price | Amount |
| 31410B8999QQK CANISTER-AUX | | 1 | 13A02 | W | | |
| 31121B8999QQK CONNECTOR-HOSE | | 1 | M003 | W | | |
| Technician | MI90245 - MICHAEL BANDELOW | | \$ | | | 0.00 |
| Cause | This bulletin provides the procedure for the installation of an add-on auxiliary canister on some 2016-2018MY Sorento (UMa) vehicles equipped with the 2.0L T-GDI engines. This is to improve evaporative system and ensure compliance Canadian emission regulation standards. | | ur | | | 0.00 |
| | | | tal | | | 0.00 |
| | | | otal | | | 0.00 |
| | | | Total | | | 0.00 |
| Correction | Installed Auxiliary Canister and Ensured the correct black O-ring is installed | | | | | |

on the auxiliary canister before canister is installed. Clean the surface of the

side member thoroughly with

degreaser and clean cloth. Perform KDS EVAP Leakage Test:

Installation w/Option Kit 2 Complete.

210A02R1.6

Job **CSR Status** Request INCIDENTALS AND NON-WARRANTY PARTS AND LABOR \$1,285.00 3 DAN Approved **GENERAL1**

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$______BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER. SERVICE CHARGE OF 2% PER MONTH (24% PER ANNUM) CHARGED ON PAST DUE ACCOUNTS. DATE SIGNATURE



5100 Shaganappi Trail N.W Calgary, AB T3A 2L7

Phone: (403) 247-2411 • Fax: (403) 202-3410

Toll Free: 1-866-459-6712

SO # 524484

SERVICE ORDER



Type

Printed 1

Labour

11/29/2021 12:57:26 PM


CUSTOMER COPY - REPRINT

User

90143

Page

Amount

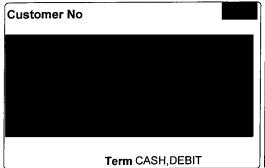

Description

 Advisor
 DAIN VEDER of Only 1/3
 Promised
 09/16/2021 4:00 PM
 Tag
 9253

 Shop
 S1
 Opened
 06/08/2021 12:13 PM
 Location

 Priority
 280
 Cashiered
 06/23/2021 3:45 PM
 PO #
 524484

| Licens | e No | Odometer In | Odometer C | Out | InServ Date | Stock No |
|---------|---------|---------------|------------|------|---------------|---------------|
| | | 124667 | 124854 | | 02/29/2016 | K56229 |
| Year | Make | Model | | | Model No | Colour |
| 2016 | KIA | SORE | NTO | | | RED |
| Vehicle | e ID No | Selling | Dealer | Exte | nded Warranty | Delivery Date |
| 5XYPK | DA17GG | 157133 | | ΧT | | 02/29/2016 |
| Engine | Size 2 | .0L I4 DIR DO | | | Fleet # | |

| GENERAL1P | INCIDENTALS AND NON-WARRANTY PARTS AND LABOR | | | | С | 265.00 |
|-------------|--|----------------------|----------------|------|-------|-------------------------|
| Part | Description | Shp | Bin | Type | Price | Amount |
| 252122GGB0 | BELT V | 1 | DR51 | CRO | 87.40 | 87.40 |
| 252122GGA1 | V-RIBBED BELT | 1 | DR50 | CRO | 84.78 | 84.78 |
| 1022510007K | NUT-SELF LOCKING | 4 | DR03D | CRO | 1.90 | 7.60 |
| 28113A9100 | FILTER-AIR CLEANER | 1 | 11B04 | CRO | 28.99 | 28.99 |
| Technician | MI90245 - MICHAEL BANDELOW | Est Parts | S | | | 0.00 |
| Cause | recall | Est Labo | our | | | 0.00 |
| Correction | Replaced Water Pump and Air conditioning / Alternnator drive belt and Engine | Parts To | tal | | | 208.77 |
| | Air filter . | Labour 7 | Γotal | | | 265.00 |
| | | Request | t Total | | | 473.77 |
| Request | Description | | | Job | CSR | Status |
| MEMO | Replace Engine as per line number 1 with check engine light is on - Towed in and customer has ENTERPRISE RENTAL Invoices | | | | | Approved |
| Labour | Description | | | | Type | Amount |
| MEMO | ENTERPRISE RENTALS | | | | W | |
| Technician | MI90245 - MICHAEL BANDELOW | Est Parts | | | | 0.00 |
| Cause | | | Est Labour | | | 0.00 |
| Correction | Kia claim reimbursement. must be added to orginal Parts Total | | | | 0.00 | |
| | | Labour T | otal | | | 0.00 |
| | | Request | t Total | | | 0.00 |
| Request | Description | | " | Job | CSR | Status |
| TRANSFLUID | Perform a complete Transmission fluid exchange and add a conditioner to add exinternal Automatic Transmission components. Road test for optimum performance | | on to all | 5 | ROB | Approved |
| Labour | Description | | | | Type | Amount |
| TRANSFLUID | Perform a complete Transmission fluid exchange and add a conditioner to add ex Automatic Transmission components. Road test for optimum performance | tra protecti | on to all inte | rnal | С | 239.82 |
| Part | Description | Shp | Bin | Туре | Price | Amount |
| K6601 | 106-306 TRANS KIT | 1 | 12A02 | CRO | 49.92 | 49.92 |
| 31553 | BG SYN ATF | 8 | SHOP | CRO | 13.78 | 110.24 |
| Technician | MI90245 - MICHAEL BANDELOW | Est Parts | 3 | | | 160.16 |
| Cause | MAINTENANCE DUE BY TIME AND/OR KMS PERFORM AUTO TRANSMISSION FLUID 48 MONTHS/48,000 KM | Est Labo Parts To | | | | 199.79 160.16 |
| Correction | COMPLETED TRANSMISSION FLUID EXCHANGE WITH CLEANER ANDCONDITIONER PACKAGE.VERIFIED CORREECT FLUID LEVEL AND ROAD TESTED NORMAL OPERATION AT THIS TIME. | Labour T Request | | | | 239.82 399.98 |

| 0 | INDEBTEDNESS IS HEREBY ACKNOW PARTS, & ACCESSORIES DESCRIBED | LEDGED IN THE SUM OF \$_ IN THIS WORK ORDER. SERVICE CHARGE OF | BEING ALL OF THE BALANCE OWING FOR REPAIRS, 2% PER MONTH (24% PER ANNUM) CHARGED ON PA | 4ST |
|---|---|---|---|-----|
| | DUE ACCOUNTS. | SIGNATURE | | |



5100 Shaganappi Trail N.W

Calgary, AB T3A 2L7

Phone: (403) 247-2411 • Fax: (403) 202-3410

Toll Free: 1-866-459-6712

SO # 524484

SERVICE ORDER

Printed Customer No

Term CASH, DEBIT

11/29/2021 12:57:26 PM

CUSTOMER COPY - REPRINT

User

90143

Page

DAIN WEDER-Advisor 09/16/2021 4:00 PM Tag 9253 **Promised** 901*4*3 Shop 06/08/2021 12:13 PM Location Opened S1 280 06/23/2021 3:45 PM PO # 524484 **Priority** Cashiered

License No **Odometer Out** Odometer In InServ Date Stock No 124667 124854 02/29/2016 K56229 **Model No** Colour Year Make Model ΚIA **SORENTO** RED 2016 **Extended Warranty** Vehicle ID No **Selling Dealer Delivery Date** 5XYPKDA17GG157133 XT 02/29/2016 Fleet # **Engine Size** 2.0L I4 DIR DO

| Request HOTOIL Labour HOTOIL | Description Perform engine Additive every 16,000 km Description Perform | | | Job 6 | CSR ROB Type C | Status Approved Amount 26.60 |
|---|---|-------------|---------------------|---------------------|-------------------------|---------------------------------------|
| Part 109 | Description ENGINE PERFORMANCE RESTORATION WAGONMASTER | Shp 1 | Bin 12A02 | Type CRO | Price 32.40 | Amount 32.40 |
| Technician | MI90245 - MICHAEL BANDELOW | Est Part | S | | | 0.00 |
| Cause | • | Est Labo | our | | | 89.95 |
| Correction | . Added to Engine oil BG 109 BG Engine Plus Service | Parts To | tal | | | 32.40 |
| | The BG Engine Plus Service covers gasoline engines. | Labour 7 | Total | | | 26.60 |
| | Service interval: Must add Within every (16,000 km) of the previous service Maximum reimbursement: Plan 2: Service Warranty up to 4,000k on internal engine work. | Reques | t Total | | | 59.00 |
| Request GENERAL1 | Description CUSTOMER STATES TO CHECK AND REPORT ON: LOSS POWER AND BLOWING BLUE SMOKE | | | | CSR DAN | Status Approved |
| Labour GENERAL1P GENERAL1P | Description CUSTOMER STATES TO CHECK AND REPORT ON: | | | | Type W W | Amount |
| Sublet 10291.1 | Description 136026/ENTERPRISE/WARRANTY RENTAL FOR S THOMPSON ** June 8th | - June 23rd | | Type WSUB | CSR DAN | Amount |
| Part | Description | Shp | Bin | Type | Price | Amount |
| 282312GTA1 B.O | TURBOCHARGER | 1 | | W | | |
| 285352G060 VAN | GASKET-CATALYST CASE | 1 | 17B03 | W | | |
| 282472G430 VAN | GASKET | 1 | 17B03 | W | | |
| 282462G430 VAN | GASKET | 1 | 17B03 | W | | |
| 282462G400 VAN | GASKET OIL DRAIN | 1 | DR29 | W | | |
| 282462C400 O.H | GASKET-T/C OIL DRAIN | 1 | DR29 | W | | |
| 1751210000 O.H | GASKET(10) | 2 | DR29 | W | | |
| 1022510007K 5 HERE, VAN | NUT-SELF LOCKING | 13 | DR03D | W | | |

| 0 | INDEBTEDNESS IS HEREBY ACKNOW PARTS, & ACCESSORIES DESCRIBED DUE ACCOUNTS | /LEDGED IN THE SUM OF \$) IN THIS WORK ORDER. SERVICE CHARGE | BEING ALL OF THE BALANCE OWING FOR REPAIRS, FOF 2% PER MONTH (24% PER ANNUM) CHARGED ON PAST |
|---|---|--|---|
| | DATE | SIGNATURE | |



5100 Shaganappi Trail N.W Calgary, AB T3A 2L7

Phone: (403) 247-2411 • Fax: (403) 202-3410

Toll Free: 1-866-459-6712

SO # 524484

SERVICE ORDER

Printed

11/29/2021 12:57:27 PM


CUSTOMER COPY - REPRINT

User

90143

W

Page

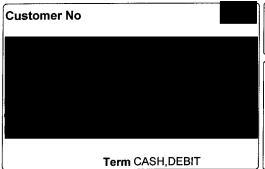

DAIL MEDEL-Advisor 9253 **Promised** 09/16/2021 4:00 PM Tag 901*4*3 Shop 06/08/2021 12:13 PM Location S1 Opened 06/23/2021 3:45 PM PO # 524484 280 Cashiered **Priority**

| Licens | e No | Odometer in | Odometer Out 124854 | InServ Date 02/29/2016 | Stock No K56229 |
|---------|-------------------|------------------------|------------------------|---------------------------|----------------------|
| Year | Make | 124667 Model | 124004 | Model No | Colour |
| 2016 | KIA | SOREN | ITO | MOGEL NO | RED |
| Vehicle | D No | Selling | Dealer Ex | ktended Warranty | Delivery Date |
| | DA17GG1 Size 2 | 157133 OL 14 DIR DO | X | Fleet # | 02/29/2016 |

5 HERE, VAN

221253C200

STUD

DR05F

Technician

MI90245 - MICHAEL BANDELOW

W90207 - WEIWEI GUO

Est Parts Est Labour 0.00 0.00

Cause

new engine installed from a No Pass Bearing Cleance test ** CONFIRM LOSS POWER AND BLOWING BLUE SMOKE POOR

ACCELERATION

Parts Total Labour Total **Request Total**

0.00 0.00

0.00

1. Check actuator movement Electronic actuator: Check for movement of the actuator rod when a forced actuator operating mode is performed by GDS. and found that the actuator rod has too much play and housing compressor wheel.. is deformed .. will requrie

new turbo charge and gaskets to fix * consequential damge from engine failure. 2. Oil leaks_ none

3.Compressor wheel .. deformed

4. Turbine wheel - deformed .

Always use the new turbo manifold module and turbo adapter gaskets when

Correction

REPLACED TURBO ASSY. PERFORMED COOLANT BLEEDING. RESET ENGINE ADAPTIVE VALUES. CLEANED LEAKING AREA.

TEST DROVE THE VEHICLE. NO LEAK AT THIS TIME. THE ENGINE OPERATION IS NORMAL AT THIS TIME.

| Request | Description | | Job | CSR | Status |
|------------|--|--|-----|------|----------|
| CUSTPA | CUSTOMER STATES CHECK AND REPORT ON : HAS TOW RECEIPTS FOR I | REIMBURSEMENT | 8 | ROB | Approved |
| Labour | Description | | | Туре | Amount |
| CUSTPA | CUSTOMER STATES CHECK AND REPORT ON : HAS TOW RECEIPTS FOR | REIMBURSEMENT ** | | W | |
| MEMO | MIKE S. ROAD TESTING VEHICLE AND COMFIRMING REPAIR | | | 1 | |
| Technician | W90207 - WEIWEI GUO | Est Parts | | | 0.00 |
| Cause | CUSTOMER STATES CHECK AND REPORT ON : HAS TOW RECEIPTS FOR | Est Labour | | | 0.00 |
| | REIMBURSEMENT ** Parts Total | | | | 0.00 |
| Correction | CUSTOMER STATES CHECK AND REPORT ON : HAS TOW RECEIPTS FOR | Labour Total | | | 0.00 |
| | REIMBURSEMENT ** | Request Total | | | 0.00 |
| Request | Description | A STATE OF THE STA | Job | CSR | Status |
| TSTORE1 | | | 9 | DAN | Approved |
| Labour | Description | | | Type | Amount |
| MOUNTO | Seasonal Tires off Rims | | | 1 | |
| Technician | J90233 - JEREMIAH EJIMOFOR | Est Parts | | | 0.00 |
| Cause | completed | Est Labour | | | 0.00 |
| | | Parts Total | | | 0.00 |

| 0 | INDEBTEDNESS IS HEREBY ACKNOW PARTS, & ACCESSORIES DESCRIBED | LEDGED IN THE SUM OF \$_ IN THIS WORK ORDER. SERVICE CHARGE OF | BEING ALL OF THE BALANCE OWING FOR REPAIRS, 72% PER MONTH (24% PER ANNUM) CHARGED ON PAS | т |
|---|--|---|---|---|
| | DUE ACCOUNTS. | CIONATURE | | |
| | DATE | SIGNATURE | | _ |



5100 Shaganappi Trail N.W Calgary, AB T3A 2L7

Phone: (403) 247-2411 • Fax: (403) 202-3410

Toll Free: 1-866-459-6712

SO # 524484

SERVICE ORDER

Odometer In

124667

Printed


11/29/2021 12:57:27 PM

CUSTOMER COPY - REPRINT

User

90143

Page

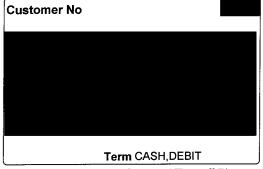

DAM VVEDER-**Promised** Tag Advisor 9253 09/16/2021 4:00 PM **0**∩1∡3 06/08/2021 12:13 PM Location Shop **S1** Opened 524484 280 06/23/2021 3:45 PM PO # **Priority** Cashiered

Odometer Out

License No Year Make 2016 ΚIA

Vehicle ID No

124854 Model **SORENTO**

Selling Dealer

02/29/2016 **Model No**

InServ Date

Extended Warranty

K56229 Colour RED **Delivery Date**

Stock No

5XYPKDA17GG157133 **Engine Size** 2.0L |4 DIR DO

02/29/2016

Fleet#

Job

10

Correction

Mounted Seasonal Tires off Rims

tires torqued to 100 ft lb pressure is set to 35 psi

customer summer tires are in the vehicle

lock nut is at the trunk(under)

job completed thank you

Description

Description

Labour Total

0.00 0.00

Status

Approved

Request **SILVER**

Perform Silver Auto Spa Package *** \$79.95 Thorough meticulous hand washing of the wheels,

exterior and drying of the vehicle exterior including door and trunk openings. Detailing of the interior including vacuuming of the seats, carpets and floor mats plus cleaning of the glass inside and out and instrument panel. Deodorizing of the interior. Apply Tire shine. Final is a detailed inspection report of the vehicle interior and exterior.

Labour SILVER

Perform Silver Auto Spa Package *** \$79.95

Thorough meticulous hand washing of the wheels, exterior and drying of the vehicle exterior including door and trunk openings.

Detailing of the interior including vacuuming of the seats, carpets and floor mats plus cleaning of the glass inside and out and instrument panel.

Deodorizing of the interior. Apply Tire shine. Final is a detailed inspection report of the vehicle interior and

Technician

C90249 - CONNOR TRNAVSKIS

Cause Correction

Performed Silver Auto Spa Package ***

Thorough meticulous hand washing of the wheels, exterior and drying of the vehicle exterior including door and trunk openings.

Detailing of the interior including vacuuming of the seats, carpets and floor mats plus cleaning of the glass inside and out and instrument panel.

Deodorizing of the interior. Apply Tire shine. Final is a detailed inspection report

of the vehicle interior and exterior. Report completed

Request Total

CSR

DAN

Amount Type

Est Parts Est Labour Parts Total

0.00 Labour Total 0.00

Request Total

0.00

0.00


0.00

Labour 719.42 **Parts** 415.46 Fees 0.00 Supplies 50.00 5.00 Env Fee SUB-TOTAL 1,189.88 GST 59.49

TOTAL INVOICE

1,249.37

INDEBTEDNESS IS HEREBY ACKNOWLEDGED IN THE SUM OF \$_____BEING ALL OF THE BALANCE OWING FOR REPAIRS, PARTS, & ACCESSORIES DESCRIBED IN THIS WORK ORDER. SERVICE CHARGE OF 2% PER MONTH (24% PER ANNUM) CHARGED ON PAST DUE ACCOUNTS. SIGNATURE DATE

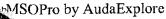







Full Repair Order



yd Canada - Cal 42nd Ave SE Branch

1201 42nd Avenue SE Calgary, AB T2G 1Z5 Phone: (403) 243-6062

GST #: 877520965

Customer & General Job Information:

Vehicle:

2016 Kia Sorento

Adjuster Phone:

VIN #:

5XYPKDA17GG157133

Adjuster Fax:

Vehicle Info:

EST Mileage = Style = 4D Ut Engine =

Estimator:

Andrew Provenzano

Estimate Date:

Date Into Store:

15/02/2018

27/02/2018 **Date Completed:**

BODY LABOR PAINT LINE PART **TYPE AMOUNT** LAB **TYPE** LAS TYPE **OPERATION** DESCRIPTION 0.0 Remove/Replace TRANSMISSION OIL \$19.17 S2 OEM 0.0 \$9.77 0.0 0,0 Remove/Replace Inform Label A/C Refrigerant \$2 **OEM** Ε 0.0 0.0 Frt Bumper Cover Remove/Install 0.0 Ε 3.4 Body Frt Bumper Cover Assy Е OEM \$681.66 0.0 0.0 Remove/Replace Frt Upr Bumper Cover Ε 0.0 2.4 Refinish Frt Upr Bumper Cover 0.0 0.0 OEM \$344.44 S2 Remove/Replace Frt Bumper Grille Remove/Replace Frt Bumper Impact Absorber Ε OEM \$208.97 0.0 0.0 Ε \$23.25 0.1 Body 0.0 OEM Remove/Replace L Frt Bumper Bracket 0.0 Е \$685.09 0.4 Body Remove/Replace Frt Bumper Reinforcement Bar OEM Remove/Replace Grille Assembly Е OEM \$1,085.54 0.0 0.0 Ε \$185.84 0.0 OEM 0.0 Remove/Replace Grille Cover Remove/Replace R Frt Combination Lamp Assembly E OEM \$1,759.95 0.3 Body 0.0 Е 0.4 Body 0.0 Headlamps Ε 0.0 0.0 Remove/Instali R Front Combination Lamp Ε 0.3 Body 0.0 L Front Combination Lamp Remove/Install Ε OEM \$863.58 1.3 Body 0.0 Remove/Replace Hood Panel E 0.0 2.8 **Hood Outside** Refinish Ε 0.0 1.4 Add For Hood Underside Refinish Ε \$29.94 0.2 Body 0.0 **OEM** Remove/Replace Frt Hood Seal 0.0 Ε 0.0 Remove/Install Hood Insulator Ε OEM \$594.30 2.8 Body 0.0 Remove/Replace Cooling Radiator **S**1 OEM \$136.11 0.0 0.0 Remove/Replace Upr Cooling Fan Guard 0.0 Ε OEM \$90.27 0.3 Body Remove/Replace Lwr Cooling Fan Guard Ε 0.0 0.0 Remove/Install Radiator A/C CONDENSOR Ε 0.0 0.0 Remove/install S1 0.0 0.0 Remove/Install Cooling Fan Assembly Remove/Replace A/C Condenser -M Ε OEM \$492.88 0.0 0.0 Ε A/M \$0.00 1.4 Mechanical 0.0 Remove/Replace Evacuate & Recharge A/C -M 8.0 R Fender Outside Ε 0.0 Refinish L Fender Outside Ε 0.0 8.0 Refinish

| ASOPro by AudaExp | plore |
|-------------------|-------|
|-------------------|-------|

| Totals Informati | ion: GST | | Est of Rec | \$: \$0.00 | Parts: | \$8,701.68 |
|---|---|----|------------|------------|----------------|------------|
| Misc W/ Tax | Hazardous Waste Disposal | | | \$5.00 | 0.0 | 0.0 |
| Misc W/ Tax | Shop Materials | | | \$27.00 | 0.0 | 0.0 |
| Misc W/ Tax | Paint/Materials | | | \$374.40 | 0.0 | 0.0 |
| Remove/Replace | Coolant \$19 for 4ltrs | S2 | A/M | \$18.25 | 0.0 | 0.0 |
| , | POST SCAN | S1 | | | 0.5 Mechanical | 0.0 |
| Misc W/O Tax | Clear Coat | E | | • | 0.0 | 2.2 |
| Remove/Replace | ADHESION PROMOTER \$10/COVER | E | A/M | \$10.00 | 0.0 | 0.0 |
| • | FLEX AGENTS \$10/COVER | E | A/M | \$10.00 | 0.0 | 0.0 |
| Misc W/O Tax | SUBJECT TO INVOICE | | | | 0.0 | 0.0 |
| Misc W/O Tax | CUSTOMER STATES VEHICLE SHAKES OVER 60KM | | | | 0.0 | 0.0 |
| Sublet | 4 WHEEL ALIGNMENT | E | SUBLET | \$125.00 | 0.0 | 0.0 |
| Remove/Replace | MASK FOR OVERSPRAY | E | A/M | \$10.00 | 0.0 | 0.0 |
| Remove/Replace | CORROSION PROTECTION \$20/1-\$15/ADDITIONA | Е | A/M | \$20.00 | 0.0 | 0.0 |
| • | Intercooler Assembly -M | E | OEM | \$633.05 | 1.6 Mechanical | 0.0 |
| | Intercooler Air Duct | E | OEM | \$87.55 | 0.4 Body | 0.0 |
| Repair | Frame measure | S1 | | | 1.5 Frame | 0.0 |
| Remove/Replace | Add To R&I/R&R Mechanical Components -M | | A/M | \$0.00 | 0.6 Mechanical | 0.0 |
| | e Frt Body Radiator Support (Com/Steel) | S1 | OEM | \$721.44 | 3.3 Body | 0.0 |
| Remove/Replace | | S1 | OEM | \$7.70 | 0.0 | 0.0 |
| Remove/Replace | • | S1 | OEM | \$7.70 | 0.0 | 0.0 |
| Remove/Replace | L Fender Flare Clip | S1 | OEM | \$16.74 | 0.0 | 0.0 |
| | R Fender Flare Clip | S1 | OEM | \$16.74 | 0.0 | 0.0 |
| Remove/Install | L Fender Mudguard | Ε | | | 0.2 Body | 0.0 |
| Remove/Install | R Fender Mudguard | Е | | | 0.2 Body | 0.0 |
| Misc W/O Tax | Line Markup %20.00 | Ε | | | 0.0 | 0.0 |
| Sublet | 3M LT/RT FENDER, HOOD | S2 | SUBLET | \$455.94 | 0.0 | 0.0 |
| Remove/Install | L Fender Wheel Opening Mldg | E | | A 4 7 : | 0.3 Body | 0.0 |
| Remove/Install | R Fender Wheel Opening Mldg | E | | | 0.3 Body | 0.0 |
| Remove/Install | L Fender Garnish | E | | | 0.1 Body | 0.0 |
| Remove/Install | R Fender Garnish | E | | | 0.1 Body | 0.0 |
| | | | | | | |

| Totals Infor | mation: | | | | GS | T XED | Est of Rec \$: | \$0.00 | Parts: | \$8,701.68 |
|--------------|-----------|-----------------|-------------------|---------------------|----|----------|----------------------|-----------------|-----------------------------------|---------------------|
| LABOR | UNITS | RATE | AMOUNT | Labor? | Y | ALD. | Appearance Allow: | \$0.00 | Paint Material: Shop Material: | \$374.40 \$27.00 |
| Paint | 10.4 | \$75.0 0 | \$780.00 | Parts? | Y | | Betterment: | \$0.00 | Hazard Waste: | \$5.00 |
| raiiit | @ | ψ1 3.00 | Ψ100.00 | Paint Mat.? | Υ | | Parts Discount: | \$0.00 | Sublet: | \$580.94 |
| Body | 14.4 @ | \$75.0 0 | \$1,080.00 | Shop Mat.? | Υ | | Ins Co Pays: S | \$12,227.33 | LKQ: | \$0.00 |
| Mechanical | _ | \$90.00 | \$369.00 | Haz Waste? | Υ | | Deductible: | \$500.00 | Towing: | \$0.00 |
| Frame | - | \$90.00 | | Sublet? | Υ | • | _ | | Storage: | \$0.00 |
| Glass | | \$85.00 | | LKQ? | Υ | | Customer Pays: | <u>\$500.00</u> | ATS Rental: | \$0.00 |
| Detail | 0.0@ | | \$0.00 | Towing? | Υ | | | | Aftermarket: | \$68.25 |
| Other | 0.0@ | \$0.00 | \$0.00 | Storage? | Υ | | | | Misc WOTAX: | \$0.00 |
| | | #0.00 | | ATS Rental? | Υ | | | | Misc. W/T: | \$0.00 |
| Paint Mat. | | \$0.00 | | Aftermarket? | Υ | | | | | |
| Shop Mat. | | \$0.00 | * 0.004.00 | Misc WOT? | Υ | | | | Total Items: | \$9,757.27 |
| Total | 30.4 | | \$2,364.00 | Resale? | N | | | | Labor: | \$2,364.00 |
| | | | | Betterment? | Y | | | | Subtotal: | \$12,121.27 |
| | | | | GST %: | | 5.00% | | | Pre-Tax Discount: | \$0.00 |
| | | | | GST Tax Reg. | | 0.00% | | | GST: | \$606.06 |
| | | | | %: | | 0.00% | | | GRAND TOTAL: | \$12,727.33 |
| | | | | Pre-Tax Disc. %: | | 0.00% | | | | |
| Discounts/N | Markups | : | | | | | | | | |

| Page | 3 of 3 |
|------|---------------|
| | A REPLACEMENT |
| | A CHARGE S |

| Date: Signature: | Date: | Signature: |
|------------------|-------|------------|
|------------------|-------|------------|

Twistedwrench Garage Inc

103 4711 13ST NE CALGARY, AB T2E6M3 Phone: 403-250-5054 GST#82142 7655 RT0001 09/12/2025 Invoice # 14988



2016 Kia Sorento SX Limited

VIN: 5XYPKDA17**GG157133**

Invoice

TURBOCHARGER - Remove & Replace - 2.0L Eng - [Includes: R&I Exhaust Manifold.]

| <u>Description</u> | Quantity | <u>Sale</u> | <u>Extended</u> |
|---|----------|-------------|-----------------|
| Turbocharger w/ Actuator | 1.00 | \$3,400.00 | \$3,400.00 |
| Exhaust Manifold GASKET | 1.00 | \$79.99 | \$79.99 |
| Catalytic Converter Nut | 4.00 | \$20.31 | \$81.24 |
| Turbo Oil Line Gasket | 1.00 | \$8.00 | \$8.00 |
| Turbo Oil Line Gasket | 1.00 | \$7.99 | \$7.99 |
| Turbo Oil Line Gasket | 1.00 | \$5.00 | \$5.00 |
| Turbo Gasket | 1.00 | \$19.99 | \$19.99 |
| Turbo Oil Line O-Ring 28 | 2.00 | \$4.65 | \$9.30 |
| Turbo Gasket | 4.00 | \$22.99 | \$91.96 |
| Nut | 11.00 | \$2.02 | \$22.22 |
| Turbo Gasket | 1.00 | \$88.00 | \$88.00 |
| Coolant Pipe O-Ring | 4.00 | \$4.00 | \$16.00 |
| Hrs: 4.50 Parts: \$3,829.69 Sublet:\$0.00 | | Subtotal: | \$4,437.19 |

MOUNT AND BALANCE TIRES AND RESET TPMS IF APPLICABLE

MOUNT, BALANCE AND INSTALL TIRES, VISUAL INSPECTION OF BRAKES AND CHASSIS, TORQUE WHEEL NUT TO MANUFACTURES SPECIFICATIONS.

| <u>Description</u> | <u>Quantity</u> | <u>Sale</u> | <u>Extended</u> |
|---|-----------------|-------------|-----------------|
| 235/55R19 Rotalla SETULA 4SEASON (3PMS) 105W XL | 4.00 | \$154.12 | \$616.48 |
| Tire Recycling fee | 4.00 | \$5.00 | \$20.00 |

Labor: \$135.00

Labor: \$607.50

Hrs: 1.00

Parts: \$616.48

Sublet:\$0.00

Tire Fees: \$20.00

Quantity

Subtotal: \$771.48

FOUR WHEEL ALIGNMENT - Adjustment - All Applicable Models - [DOES NOT include unsiezing rusted fasteners, straightening or replacement of components CAMBER/CASTER (Rear toe) may require additional time and parts.]

MEASURE CASTER, CAMBER AND TOE. COMPARE TO VEHICLE SPECIFICATIONS. SET AND ADJUST TOE (FRONT AND REAR) TO APPROVED ALIGNMENT ANGLES WITH ALLOWABLE SPECIFICATIONS. CAMBER AND CASTER MAY BE ADDITIONAL LABOR

Labor: \$135.00

Hrs: 1.00 Parts: \$0.00

Sublet:\$0.00

Subtotal: \$135.00

Extended

DIFFERENTIAL CARRIER SUPPORT BUSHING - Remove & Replace - 4WD

| | <u>Description</u> | | | <u>Quantity</u> | <u>Sale</u> | <u>Extended</u> |
|------------------------|--------------------|----------------|---------------|-----------------|-------------|--------------------|
| • | Differential House | ing Insulator | · | 1.00 | \$24.95 | \$24.95 |
| Labor: \$675.00 | Hrs: 5.00 | Parts: \$24.95 | Sublet:\$0.00 | | Subtota | l: \$699.95 |

HEADLAMP BULB - Remove & Replace -RIGHT- [DOES NOT include adjustment.]

| Description | Quantity | <u>Sale</u> | Extended |
|----------------------|----------|-------------|-----------------|
| Headlight Bulb-Outer | 1.00 | \$108.25 | \$108.25 |

Subtotal: \$148.75 **Sublet:**\$0.00 **Labor:** \$40.50 **Hrs:** 0.30 **Parts:** \$108.25

WHEEL RE TORQUE, we had your wheels off we strongly recommend that we RE TORQUE your wheel lug nuts around 100k, This can be done anytime, FREE, and only takes 5min, just swing by and we will gladly RE TORQUE your wheels



09/12/2025 Invoice # 14988

Continued From Previous Page

Service Advisor:,

WHEEL RE TORQUE MAY BE REQUIRED,

If for any reason we had your wheels off we strongly recomend that we RE TORQUE $\,$ your wheel lug nuts after 100k, This can be done anytime, FREE, and only takes 5min, just swing by and we will gladly RE TORQUE your wheels

WARRANTY on parts and labor is 3 months or 3000 kilometers whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

WARRANTY IS NON TRANSFERABLE / NEGOTIABLE

WE ARE NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS WHILE PARKED IN OUR LOT

\$1,593.00 Labor Total: \$4,579.37 Parts Total:

\$39.83 Shop supplies: Waste management: \$91.59

Tire Fees:

\$6,323.79 Sub Total: Tax Total: \$316.19 Grand Total: \$6,639.98

Balance Due: \$0.00



SIGNATURE...... DATE....... DATE......

Payment(s)

2025-08-28 9:28:45AM \$2,750.00 Visa


2025-09-10 10:20:32AM \$2,500.00 Interac/debit 2025-09-12 12:17:24PM \$1,389.98 Visa


twistedwrenchgarage.com

\$20.00

2XXPKDA17GG157133 9/11/26 9:27 AM R001530

Kia: Sorento: 2016: All Wheel Drive 4-Wheel Total Alignment

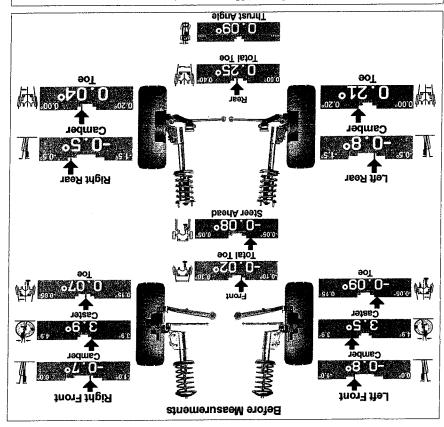

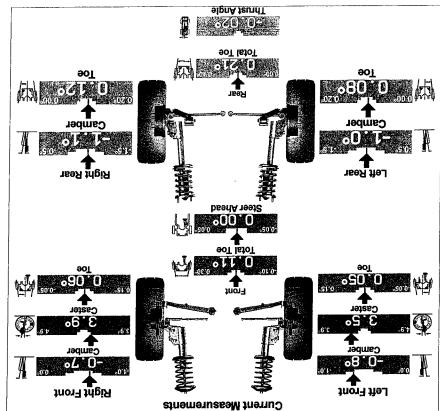

| Alberta collision REPORT FORM | Collision 0930070 | Continuation No. | | Police Service | Police File No. 100515 | ac a | IP Zode No Page |
|---|---|--|-------------------|-----------------------------|--|--|---|
| THE TOTAL COLLISION REPORT FORM | Case No. 0930079 | | | CPS | 180515 | U8 : | 1 1 1 |
| X in City, Town, Village Hamlet of CALGARY Near CALGARY | (Give National Park, inc | lian Reservation) | | | Occurrence Date 2018 - 02 - 03 | Occurrer 00:00 | ice Time (24 hour clock) |
| On Primary/Secondary Hwy. No. OR | Sheet Avenue: CROWCHILD | TR NW | | | Reported Date 2018-02-03 | Time Rei | ported (24 hour clock) |
| Al Intersection Primary/Secondary Hwy, No. OR | Street/Avenue 24 AV NW | | | | File Status | 13:50 | :00 |
| If Not at route | | ahwest Town esta | | | t Sui X 7 Conc | cluded 3. Forward To | Diary Date |
| Intersection km Special Intermediate the processing the pr | N S E W /, enter name | | | octal Road Road Coll | 1. Fatal 2 Ins | Total No. | 4 |
| Special If location can be described more precised Reference | | | | cilly Alignment Class Loca | Mon Veh. | Injured ⁰ | Total No. Fatulities 0 |
| Do Nor Write in | | | | | X Original Report Amended Report | Hit and Run | No I me X 2 % |
| This Space | | | | real and a | | 99 2 | , |
| Primary 01 STRUCK OBJECT 02 OFF ROAD 1 | | 04 PASSING LEFT | TURN 05 LEFT | TURN - ACROSS PATH 06 S | DESWIPE 07 | OTHER/SPECIFY | |
| 08 08 REAR END 09 OFF ROAD | RIGHT 10 HEAD ON | 11 PASSING - RIGH | | ····· 13 B | SITE DIRECTION ACKING | | |
| 1 01 1 Driver 3 Motorcycles 5 Parked Ve | | | SAME DIR | ECHON | | Initial Point of Impa | |
| 2 Pedestrian 4 Bicyclist 6 Train | 8. Other Ven | | | | | Vehicle 08 | Werhapite 04 |
| | | | | | | | 12 03 / |
| | | | | | | | |
| Date of Birth Sex Home Phone | Work Phone | . | | | | 136 | 09) - 04 12 |
| | | | | | | 97 | |
| Prov / State AB | /alid Licence Proper Class 1. Yes 2. No 1, Yes 2 | 2. Na | | | | 10. Undercamade 11. Rollover | 12. Atrachment 99. Unknown |
| Year Make Model SORENTO | Color OTHER | | | | | Sumame | Name |
| Prov /Slate VIN 5XYPKDA17GG15 | 37133 | | | | | Address | |
| Dangerous Class PIN Goods | | | | | S. | Aratress | · |
| Company Name/Leased By | | Company Name/Leased B | ý | | SSA | Home Phone | Work Phore |
| Fast Name | inse | | | | | | |
| Aritrens | | | | | EN T | Surrame | Marie |
| | | Aridensa | | | END | Address | |
| Address Frame Phone | • Work Phone | | | Hame Phone V | Vork Phone iii | Aktress | |
| | | ************************************** | | , | | Home Phone | Work Phone |
| | 2018 09 2 | 0 | | | | Additional Witnesses on Fl | |
| Object * Position Safety Injury Age Sex Pos | ition in Venicle | /3 5 9 | 1 | 20: | 18 03 01 | 1 Ves | 2. No |
| | river 11 Bicyclist Passengertsi 12 Penestnan | 2 5 9 | | | | Address | |
| 2 1 2 1 59 Tu | Motercyclist 38 Other 39 Unix oty Equipment Used | 70wn 1 4 7 | | | | | |
| 11.2 | | 5. Ampag 6. Chiki satety/booster seat | 98. Other Specify | F. Warring | The state of the s | Address | |
| 3.5 | booker belt only tre, automatic beltt | 7. Helmet | 99. Uinknown | Surname | Name | Address | |
| e Injur | y Seventy | | | Surrama | Marixo | Addrass | |
| 1 1 1 2 1 | | Major (admitted to hospi Falal (death occurred will Include date and time of | | Surname | Name: | Address | |
| Inventigator AC84101 Segnature | | Urst App | गण्यां (२) | Staurino | | $D_i t^i x$ | |
| This information is collected under the authority of | | 3FC Req | | | | Charles of the Control of the Contro | |

This information is collected under the authority of the Traffic Safety Act (TSA) for the purpose of reporting and investigating a motor vehicle accident and compiling statistics. The information is disclosed in accordance with the TSA. Contact Transportation Safety at 4999 - 98 Avenue, Edmonton, AB T6B 2X3 (780) 427-8901 or toll free 310-0000 if you have any questions regarding this information.

Albertan Government

Alberta Collision Report Witness Statement

Law Enforcement Agency

| | 12.5 | | | | | |
|----------|-----------|----------|------------|-------------------|----------------|-----|
| 2000 100 | Section 1 | 4.20.000 | 1 A. 18 A. | 79 N O.A | Section 1 | |
| !Cas | se Fil | e Nun | iber | 44 A. B. | 20.00 | |
| 13.14 | | | | | | |
| 14.8 | | | | | | |
| | | | | | V. | |
| 224 | | | | 15-17 | 4. uj 9es 174. | à. |
| 100 | 1.000 | A. 12 | C. A. C | Acres to a second | AND PERSONS | 4.0 |

Your statement should include:

- date and time of the collision;
- an explanation of the events leading up to the collision; direction of travel of all vehicles involved;

| _ | the etre | ote/ava | DUDE W | horo the | COlligion | occurred; |
|---|-----------|------------|--------|----------|-----------|-----------|
| • | 1110 3110 | CLO/ Q V C | HUCS W | HOLO HIO | COMBION | occurred, |

| Toonsent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | • identify other drivers and witnesses, when possible. | 로마 (1) 전에 가장 이렇게 살았다면 보고 함께 함께 되는 이번 다른 것이다. 보고 있는 것이 되는 것이 되었다면 보고 있다면 되었다. |
|--|--|---|
| It is unlawful to make a false statement. STATEMENT TOK CADA SECTION OF A STATEMENT TOK CADA SEC | Please ensure this statement is signed and dated. | |
| It is unlawful to make a false statement. STATEMENT TOTAL CONTROL OF THE STATEMENT STATEMENT TOTAL CONTROL OF THE STATEMENT | | □ Driver □ Passenger □ Pedestrian □ Witness □ Other |
| Toonsent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| Toonsent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| Toonsent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| Toonsent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| DRIVING CAST CAN CROUCHID TRAIL DAWN + FOR CANDISCUSTERLAND BAND BAND SIDD IN A PRODUCTION AND BAND DIAGO TO CONSENT to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | It is unlawful to make a false statement. | |
| Toosent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | STATEMENT | |
| Toosent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | DAMPS EAST ON C | reached trait show + |
| Significant to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| Consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | - POCK CUNDENDED OF | WHEAVE DAVE IN THE |
| Consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | - A) 1/4 1/200 A/0 | Exercisest AVI T brated |
| Consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| Consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | - And the showing | to the train of the |
| Consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | TV211CP KENTER | フィア・トーント リッパ・バンドトト |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | 요한 그는 항상 보면 되었다면 하는 것이 되는 것이 없는 것이 없는 것이다. |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | 경기 전에 가장 보고 있는데 되었다. 그 경에 대한 다른 그 경에 가장 그렇게 되었다. 전혀 전혀 있는 것은 기능한 것은 것으로 보고 있는데 기를 하는데 되었다. 그 것은 것을 보고 있다. | 교육 강경 경기 전 경기 사용 기업 경기 전 경 |
| Consent to the investigating law enforcement agency releasing a copy of this statement to any person, agency, | | |
| or other entity upon request. | or other entity upon request. | 사람들이 가득하는 이 승규는 모든 사람들이 되었다. 사용 소리를 가지 않는 것이 되었다. |

This information is being collected for the purpose of collecting additional or supplemental information from the persons who have knowledge of a collision. The information is collected and is disclosed in accordance with and under the authority of the Traffic Safety Act (TSA), Operator and Vehicle Licensing Control Regulation and the Freedom of Information and Protection of Privacy Act. Contact Alberta Transportation at 4999-98 Ave, Edmonton, AB T6B 2X3 780-427-8901 or toll free 310-0000.

| | | | | RY IN | | |
|--|--|--|--|-------|--|--|
| | | | | | | |

| The second section of the second seco | Bright Committee Agreet Golden Committee Street Bright Street Committee | and Atlanta description of the | 4. 日本、統元公司、大学、日本、日本、日本、日本、日本、日本、日本、日本、日本、日本、日本、日本、日本、 | | - Date | Page of |
|--|---|--------------------------------|---|--------------------------------------|--|--|
| Regimental Number Name | | innotitre. | | 化复数延迟 医海流性 医物质性 医多种腺素 阿克 网络伊尔兰美国西部 | | Page of |
| Regimental Number Name | | ignature/ | | | | resident and the control of the cont |
| | THE TENTH OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY. | | | | Parks of the Court | |
| To an a management of the property of the prop | | | 3 | 14、中国作品的,但"解释"和多种 网络特别斯斯特特特的 | | |
| The state of the s | | | B. C. | | year month | day I 💮 I |
| | | Long | | | 表。1980年1月1日 · 1980年1月1日 · 1980年1月1日 · 1980年1日 · 19 | |
| TOTAL ALABAM | INECHAN | 11 / / 1 | | 보이가 그 회사 나는 이번 가고 한 문에 선생님들이 없다면 됐다. | | |
| | DIAM CHARA | 7/// | | | | |
| 84101 NAKO | | | | 1 231 (| 3 1 34 73 -31 | |
| | | | | |) 11 8 01 01 01 01 01 01 01 01 01 01 01 01 01 | Sand 1 |
| | | | | 항공하다면 하기 하는 한 없다고 있는 것이 어느를 하였다. | and the second of the second o | State of the control of the second of the se |
| A COMPLETE OF THE PROPERTY OF | | 4 | | | | |
| | | <i>t</i> . | | | | |