

**Invoice**

[Redacted Customer Information]

Description Silver 2009 Ford F-150 FX4 V8 5.4L 330CID VIN  
V  
VIN 1FTPW14V09FB29956  
Odometer 199,968 In / 199,968 Out

Invoice # 39758  
Work Order # 48484  
Service Advisor Steph  
Technician Darrin

Invoice Date 7/21/2022 1:42 PM  
Appointment 7/18/2022 12:52 PM  
Promised 7/18/2022 5:00 PM

**Inspection**

**20 Point Preventative Maintenance Inspection**

Labor	\$0.00 *G
<b>Sub</b>	<b>\$0.00</b>

wheel torque 150lbs

**Service**

**Automatic Transmission Fluid & Filter Service**

Remove and Replace components as required to access and install materials, and/or perform needed service, adjustments as required. Remove existing fluid(s). Additional chemicals may be added to completely clean system contamination. Fill system fluid(s) to proper capacity with new fluid. Fluid additives and/or conditioners may be required. Leak test vehicle system. Perform final road test where applicable.

Labor	\$325.50 *G
Automatic Transmission Filter Kit - Rubber Coated Metal - OE Style - Carded	\$163.86 EG
FORD MERCON TRANSMISSION FLUID LV	\$94.92 G
<b>Sub</b>	<b>\$584.28</b>

**Exhaust Manifold - Replace Broken Bolt Left Side**

Remove and Replace components as required to access and install materials, and/or perform needed service. Retest and verify repair as required. Perform final road test where applicable.

Labor	\$604.50 *G
Extra labour to remove broken exhaust manifold studs	\$217.00 *G
Exhaust Manifold Stud Kit	\$35.96 G
Exhaust Manifold	\$288.99 G
<b>Sub</b>	<b>\$1,146.45</b>

**Tech Note:**

Monitor right side exhaust, could see where manifold bolts have been replaced, we retorqued and seems to be ok.

**Auto Trans Seal**

Remove and Replace components as required to access and install materials, and/or perform needed service, adjustments as required. Additional fluids may be required to complete this service. Retest and verify repair as required. Perform final road test where applicable.

replace electrical bulkhead connector at transmission	\$372.00 *G
Bulk Head Connector	\$40.20 G
seal kit	\$28.60 G
<b>Sub</b>	<b>\$440.80</b>

**Cooling System General Service**

clean coolant overflow tank - cooling system was flushed on last wo  
Flushed coolant tank, tank is stained, coolant is clean.

<b>Sub</b>	<b>\$0.00 *G</b>
<b>Sub</b>	<b>\$0.00</b>

Total Parts	\$652.53
-------------	----------

Total Labor		<u>\$1,519.00</u>
Total Before Taxes & Miscellaneous Charges		<u>\$2,171.53</u>
(*) Shop Supplies / Hazardous Waste / Environmental Compliance Fees		\$122.27 G
(G) Canadian Goods and Services Tax (GST)	5 %	<u>\$114.69</u>
<b>Grand Total</b>		<b><u>\$2,408.49</u></b>



TERMS STRICTLY CASH UNLESS ARRANGEMENTS MADE. GST# 122315294.

I hereby authorize the repair work hereinafter set forth to be done along with the necessary material and agree that to the extent permitted by law, you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and /or inspection. An express mechanic's lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. All vehicles not picked up by customer after three (3) days from completion, are subject to a storage fee of no less than \$25.00 per day.

Customer's Signature: X \_\_\_\_\_

Invoice payable upon receipt.

RE-TORQUE WHEELS AFTER 100 KM.

PLEASE NOTE! Warranties covering most aftermarket and performance parts are covered by the manufacturers warranty. These warranties will vary in length of time of coverage depending on the manufacturer. There is very seldom any clause covering any labor, towing or inconvenience charges. These charges become the responsibility of the vehicle owner.

**IMPORTANT NOTICE:  
 CUSTOMER TAKE OFF PARTS POLICY:**

Customer Must indicate at time of Vehicle Check In or Drop Off if Take Off Parts are to be Returned to Customer.  
 Some Parts May have a Core Value which Will Be Charged on Invoice if Returned to Customer.  
 Any or All Customer Take Off Parts left on our Premise for more than fourteen (14) days from Posting Date of Invoice Will Be considered forfeited.  
 Dale Adams Automotive Will Not be responsible in any way for Parts Left on Premise after fourteen (14) days.

**Invoice**

[Redacted]

Description Silver 2009 Ford F-150 FX4 V8 5.4L 330CID VIN  
V  
VIN 1FTPW14V09FB29956  
Odometer 197,857

[Redacted]

Invoice # 38548  
Work Order # 46870  
Service Advisor Derek  
Technician Steve

Invoice Date 11/30/2021 10:46 AM  
Appointment 11/1/2021 7:19 AM  
Promised 11/30/2021 4:00 PM

**Concern**

**Heater / A/C Actuator Noise**

When you turn on heat control has clicking noise in dash, pretty sure it is an actuator motor

**Inspection**

**20 Point Preventative Maintenance Inspection**  
Labor

\$0.00 \*G  
Sub             
**\$0.00**

**Service**

**Diagnose HVAC Actuator Noise**

Initial diagnosis, testing and inspection of the specific vehicle system as required. Perform road test where applicable. Report test result(s), system fault(s), component(s) failure and required repair(s). Additional diagnosis and testing time may be required at additional charges.

Cold started vehicle can hear temp mode door hunting when adjusting dial. Has code stored. Hvac is single not dual zone, blower motor squealed on lower speed settings too. Has B1081-00 Left Temperature Damper Motor - Current DTC. Can hear clicking noise in dash, sounds like it is loudest on drivers side.

Sub             
**\$77.50**

**Valve Train Replacement - Cam Phaser Lock-out**

Customer wants valve train replaced and cam phaser lockout completed

On cold start watched data on scan tool and listen for phaser noise, vehicle and scanned for trouble codes - Has P0341-00 Camshaft Position Sensor "A" Circuit Range Performance Bank1, P0346-00 Camshaft Position Sensor "A" - Bank 2 Codes Present, due to age mileage would recommend pulling timing cover to inspect as is variation on timing from bank to bank, possible worn guides or chain stretch.

Sub             
**\$77.50**

**Cooling System Fluid Exchange**

Drain and refill system fluid(s) to proper capacity with new fluid. Fluid additives and/or conditioners may be required. Leak test vehicle system. Perform final road test where applicable.

Labor \$155.00 \*G  
FORD GOLD LONG LIFE ANTIFREEZE \$93.08 EG

Sub             
**\$248.08**

**Power Steering Hose - Replace - Pressure Hose**

Includes removal of components required for access. Includes bleed and refill fluid.

Combination with steering rack replacement \$232.50 \*G

Power Steering Pressure Hose - OEM \$212.82 G  
**Sub** \$445.32

**Steering Rack and Pinion**

Remove and Replace components as required to access and install materials, and/or perform needed service. Additional fluids may be required to complete this service. Retest and verify repair as required. Perform final road test where applicable.

Labor \$604.50 \*G  
 Rack and Pinion - Power - Complete \$617.63 G  
 FORD AUTOMATIC TRANSMISSION FLUID MERCON V \$31.92 G  
**Sub** \$1,254.05

**Ball Joint(s) - Lower - Replace**

Includes removal of components required for access.

Labor \$325.50 \*G  
 Ball Joint - Front Lower \$115.78 G  
**Sub** \$441.28

**Alignment, Four Wheel**

Inspect steering and suspension system components. Connect alignment equipment to verify and adjust front and rear wheel alignment settings for caster, camber, and toe in/out settings, thrust angle where applicable and center steering wheel. Some vehicles may require installation of alignment shims at additional charges. Adjust to meet manufacturers' specifications. Perform final road test where applicable.

Labor \$217.00 \*G  
**Sub** \$217.00

**Valvetrain - Replace Timing Chains / Guides/ Phasers / Perform VVT Lockout & Programming**

Replace Spark plugs at same time

Labor \$2,015.00 \*G  
 Timing chain kit - includes chains, tensioners, guides, sprockets, bolts \$1,189.42 G  
 Timing cover gasket set \$159.11 G  
 Valve cover gasket set \$113.18 G  
 Phaser Lock Out Kit \$194.38 G  
 Spark Plug - Iridium IX \$149.60 G  
 Serpentine Belt and Tensioner Kit \$331.12 G  
 Intake Manifold Gasket \$189.53 G  
 Programmed out came phasers and related codes. \$155.00 \*G  
 License Fee \$199.95 G  
**Sub** \$4,696.29

**Lube, Oil & Filter Service - Conventional Oil**

Drain and refill engine oil, change engine oil filter and lubricate chassis grease fittings and friction points as required. Check and top off fluid levels, additional charges may apply where fluids are required. Complete a complimentary visual vehicle inspection.

Labor \$48.00 \*G  
 5W20 ENGINE OIL \$56.63 EG  
 OIL FILTER \$10.91 EG  
 Windshield Washer Fluid \$4.65 G  
**Sub** \$120.19

Total Parts	\$3,669.71
Total Labor	\$3,907.50
Total Before Taxes & Miscellaneous Charges	<u>\$7,577.21</u>
(*) Shop Supplies / Hazardous Waste / Environmental Compliance Fees	\$325.10 G
(G) Canadian Goods and Services Tax (GST) <span style="float: right;">5 %</span>	<u>\$395.12</u>
<b>Grand Total</b>	<b>\$8,297.43</b>

- 2009 Ford F-150 FX4 [1FTPW14V09FB29956]

20 Point Preventative Maintenance Inspection

20 Point Preventative Maintenance Inspection	O	S	R	N/A	
Exterior Lights / Marker Lights / Horn					no reverse light operation
WINDSHIELD WIPERS ** / Washer / Fluid					
Battery & Cables					Battery could use a service
DRIVE BELTS ** / TIMING BELT **					rust on pulleys and belt age
COOLANT ** Strength ___ pH Level ___					-50 8ph contamination in coolant /tank
AIR FILTER ** / Underhood Fluid Levels					brake fluid dirty
TRANSMISSION FLUID **					trans fluid marginal dark
___ LF ___ RF ___ LR ___ RR ___ Psi Tire Tread Depth / Pressure					LF 48psi RF 48psi LR 48psi RR 48psi LF9MM RF9MM LR7MM RR7MM needs rotation
Brake Friction Material Front ___/32					LF 8mm RF 8mm LR 6mm RR 6mm
Brake Friction Material Rear ___/32					LF 8/32" RF 8/32" LR 6/32" RR 6/32" marginal rust on inside of rear rotors compromising braking and will shorten rear brake life
CV Joints / Boots / Driveshaft					
Struts / Shocks					
Steering Linkage					slight play left inner tie rod or rack/ rack leaking right, lower ball joint play, power steering pressure hose leaking
Exhaust / Undercarrige					left manifold leak bolt broken
Brake Lines / Brake Hoses					
Fuel Lines / Fuel Hoses / FUEL FILTER **					age?
Differential / Final Drive					rear diff marginal dirty
Other _____					



FOUNTAIN TIRE (NORTHLAND DRIVE ) LTD.

4911 NORTHLAND DR NW  
CALGARY AB T2L 2K3

INVOICE



AIR MILES.


Order Number: 090SWO00222353  
Service Contact: AKASH CHANDI-

Phone: 403.286.3386  
Fax 403.247.1944  
F090@fountaintire.com  
889335287RT0001

Date: 19/07/2025  
Invoice: 090I202144  
PO#:  
AirMiles # :

Bill to Customer 090C00057518 Ship to Customer: 090C00057518

Year: 2009 Unit:  
Make: FORD TRUCK  
Model: F150 PICKUP  
Design:  
Engine: V8-330 5.4L SOHC  
Colour: SILVER  
Vin: 1FTPW14V09FB29956  
Mileage: 216926 Hours: 0

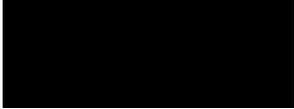

Item number	Item description	Qty	Unit price	Total
<b>Pickup / SUV Tires, Wheels and Service</b>				
TSB020	4 Tire Change-over, balance, Valve Stem or TPMS Reset, Nitrogen - 275/65R18 MICHELIN DEFENDER LTX @9/32NDS" - 275/65R18 BFGOODRICH A/T @12-13/32NDS" - LUG NUTS WERE EXTRTEMELY TIGHT, LUG NUTS SWOLLEN, RECOMMEND REPLACING, REPLACED - FRONT SENSORS DEAD, RECOMMEND REPLACING, REPLACED - OIL CHANGE DUE BY STICKER ON WINDSHIELD, BOTH REVERSE LIGHTS OUT, RECOMMEND REPLACING	1.00	\$168.00	\$168.00
<b>Tire and Wheel Parts / Hardware</b>				
090-NUT	SPLINE/ACORN NUT	24.00	\$3.95	\$94.80
090-50812	AUTEL MX-Sensor Programmable TPMS	2.00	\$69.95	\$139.90
<b>Other Miscellaneous Items</b>				
SHOP	Shop Supplies	1.00	\$25.20	\$25.20
T	Thank you for choosing Fountain Tire, we appreciate your business	1.00	\$0.00	\$0.00

These parts and services were recommended for replacement or repair

Item Description	Qty	Unit price	Net amount
Electrical System - Service	0.30	\$155.00	\$46.50
REAR TURN SIGNAL	2.00	\$3.18	\$6.36
Full-Synthetic Oil Change -Up to 7L	1.00	\$114.95	\$114.95
Oil Filter	1.00		
Environmental Fee - Oil Filter	1.00	\$1.00	\$1.00
5W20 Full-Synthetic Oil	7.00		
Environmental Fee - Fluids	7.00	\$0.50	\$3.50
Full-Synthetic Service Package	1.00		
Sub Total:			\$172.31

This estimate is valid for 30 days and excludes sales taxes



FOUNTAIN TIRE (NORTHLAND DRIVE ) LTD.

4911 NORTHLAND DR NW  
CALGARY AB T2L 2K3

INVOICE



Order Number: 090SWO00222353  
Service Contact: AKASH CHANDI-

Phone: 403.286.3386  
Fax 403.247.1944  
F090@fountaintire.com  
889335287RT0001

Date: 19/07/2025  
Invoice: 090I202144  
PO#:  
AirMiles # :

Bill to Customer 090C00057518

Ship to Customer: 090C00057518



Year: 2009 Unit:  
Make: FORD TRUCK  
Model: F150 PICKUP  
Design:  
Engine: V8-330 5.4L SOHC  
Colour: SILVER  
Vin: 1FTPW14V09FB29956  
Mileage: 216926 Hours: 0

Item number	Item description	Qty	Unit price	Total
-------------	------------------	-----	------------	-------

Air Miles: 0

Invoice comment

I acknowledge: (1) receipt of goods and services; and (2) Fountain Tire may conduct a registry search to verify the VIN on my vehicle if required for collection purposes on unpaid invoices related to my vehicle.

The customer is to ensure all wheel lugs are re torqued by a qualified technician before the vehicle has travelled 100 kilometers.

Parts:	\$234.70
Services:	\$193.20
Sub Total:	\$427.90
GST:	\$21.40
<b>Total: (CAD)</b>	<b>\$449.30</b>

Pay type: VisaCard \$449.30

